

Home Report

One triangle, all angles covered

RESIDENTIAL / COMMERCIAL / PROPERTY & CONSTRUCTION



Contents

- 1. Single Survey
- 2. Energy Performance Certificate







Scottish Single Survey



survey report on:

Property address	32 Poplar Park Port Seton Prestonpans EH32 0TD
Customer	Mr and Mrs Colin Sturrock
Customer address	32 Poplar Park Port Seton Prestonpans EH32 0TD
Prepared by	Shepherd Chartered Surveyors
Date of inspection	13/03/2024



www.shepherd.co.uk

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by marking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller:
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
 or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report².

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments

being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 <u>Category 2:</u> Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use

communal grounds, parking areas, and other facilities;

- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	Two storey detached house.	
Accommodation	Ground Floor: Entrance Hall, Living Room/Dining Room, Kitchen, Family Room, Utility Room and WC. First Floor: Four Bedrooms (one with En Suite Shower Room) and Bathroom with WC.	
Gross internal floor area (m²)	The gross internal floor area extends to 142 sq m or thereby.	
Neighbourhood and location	The subjects are situated in a modern residential estate lying within the East Lothian village of Port Seton being convenient for all local amenities with further amenities being found within the town of Prestonpans located approximately 2 miles to the west.	
Age	1997 approximately.	
Weather	Light rain.	
Chimney stacks	None.	

Roofing including roof space Sloping roofs were visually inspected with the aid of binoculars where appropriate. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The roof is pitched and tiled with a flat platform over the gable and rear extension, presumably covered in a waterproof membrane. Access was afforded into the main roof void via a hatch within the first floor landing. The roof void has been partially floored. Access was restricted due to the presence of stored items and insulation. Access was afforded into the extension roof void via a hatch within the utility room. A head and shoulders inspection was carried out only. Rainwater fittings Visually inspected with the aid of binoculars where appropriate. PVC gutters and downpipes. Main walls Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The main walls are built of traditional cavity block construction with facing brick finishes. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows throughout are of a PVC double glazed style with a timber double glazed unit within the WC. The front access door is of a timber variety. There is a PVC double glazed access door in the utility room. There are PVC patio doors

garden.

within the living room and PVC double glazed French doors within the family room, both providing access to the rear

External decorations	Visually inspected.
	PVC and painted timber finishes.
	1 vo and painted timber limishes.
Conservatories / porches	None.
Communal areas	None.
Communar areas	None.
Garages and permanent outbuildings	Visually inspected.
	There is a single integral garage with a metal up and over access door. The garage was full of possessions at the time of inspection.
Outside areas and boundaries	Visually inspected.
	The property benefits from private garden grounds to the front, rear and side of the property bounded by timber fencing, where defined, and incorporating a private driveway. Timber decking has been installed in the rear garden.
Ceilings	Visually inspected from floor level.
	Plasterboard ceilings.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Internal walls are of plasterboard construction.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	Flooring at ground floor level is of solid masonry with timber construction at first floor level.

Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The kitchen fittings comprise wall and base units with worktop surfaces areas present. The internal doors, skirtings and facings are of a timber variety.
Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	There is a gas fire within the living room.
Internal decorations	Visually inspected.
	Painted throughout.
Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern
	standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains supply with the meter and consumer unit located within the garage.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains supply.

Water, plumbing, bathroom fittings

Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.

No tests whatsoever were carried out to the system or appliances.

Mains supply. The plumbing, where seen, is of copper supply pipes and PVC wastepipes. The sanitary fittings comprise a two piece suite within the WC, two piece suite plus shower in the en suite shower room and a three piece suite within the bathroom.

Heating and hot water

Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.

No tests whatsoever were carried out to the system or appliances.

The property benefits from a gas fired central heating system to steel panelled radiators with the boiler located within the garage. Hot water is provided by the central heating system with the hot water tank located within a first floor landing cupboard.

Drainage

Drainage covers etc. were not lifted.

Neither drains nor drainage systems were tested.

Drainage is presumed to be to the main public sewer.

Fire, smoke and burglar alarms

Visually inspected.

No tests whatsoever were carried out to the system or appliances.

All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbonfuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership.

Any additional limits to inspection

For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

The property was fully furnished and fully floor covered at the time of inspection.

The cupboards were filled with storage items.

No access was available beneath sanitary or kitchen fittings.

Windows and external doors were not all fully opened or tested.

No access was available to any sub-floor areas.

Access was restricted within the main roof void.

A head and shoulders inspection of the extension roof void was carried out only.

The external fabric of the building was inspected from ground level only.

Flat roof coverings were not inspected.

The garage was full of possessions.

An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.

Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- (4) Flashing
- 5) Ridge ventilation
- 6 Ridge board
- (7) Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- (12) Sarking
- 13) Roof felt
- (14) Trusses
- (15) Collar
- 16) Insulation
- (17) Parapet gutter
- 18) Eaves guttering
- (19) Rainwater downpipe
- 20) Verge boards/skews
- 21) Soffit boards
- 22) Partition wall
- (23) Lath / plaster
- (24) Chimney breast
- 25) Window pointing
- 26) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29 Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- (33) Damp proof course
- 34) Base course
- (35) Foundations
- 36) Solum
- Floor joists
- 38) Floorboards
- 39) Water tank
- 40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movement	
Repair category	1
Notes	There was no evidence of significant structural movement within the limitations of our inspection.

Dampness, rot and infestation	
Repair category	1
Notes	Damp meter readings were taken where considered appropriate within the property and moisture levels were found to be within an acceptable range. We have presumed that those areas not inspected are free from defect.

Chimney stacks	
Repair category	N/A
Notes	None.

Roofing including roof space	
Repair category	2
Notes	There is a flat roof and it should be appreciated that this type of covering can have a limited life span and will require a higher than normal degree of ongoing maintenance and eventual replacement. It may be prudent to confirm the service history of the roof covering. We always recommend a precautionary check of the roof and pertinents is undertaken prior to purchase especially after adverse weather conditions.

Rainwater fittings	
Repair category	1
Notes	Within the limitations of our inspection rainwater goods were seen to be free from significant defect.

Main walls	
Repair category	1
Notes	Within the limitations of our inspection, no significant defects were noted, however normal levels of maintenance are recommended.

Windows, external doors and joinery	
Repair category	1
Notes	Windows were not all fully opened or tested, and it should be appreciated that some defects are only evident during certain weather conditions. Within the limitations of our inspection, no significant defects were noted.
	A precautionary check of all windows and doors is always recommended prior to purchase.

External decorations	
Repair category	1
Notes	Paint finished and decorated external surfaces will require redecoration on a regular basis.

Conservatories/porches	
Repair category	N/A
Notes	None.

Communal areas	
Repair category	N/A
Notes	None.

Garages and permanent outbuildings	
Repair category	1
Notes	The garage was full of possessions and at the time of inspection not all areas could be inspected.

Outside areas and boundaries	
Repair category	1
Notes	Boundary walls and fences should be regularly checked and maintained as necessary.

Ceilings	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Internal walls	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Floors including sub-floors	
Repair category	1
Notes	Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition.

Internal joinery and kitchen fittings	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Chimney breasts and fireplaces	
Repair category	1
Notes	All flue linings should be checked, repaired if necessary and swept prior to fires/appliances being reused.

Internal decorations	
Repair category	1
Notes	The property is in good decorative order.

Cellars	
Repair category	N/A
Notes	None.

Electricity	
Repair category	1
Notes	The Institution of Engineering Technology recommends that inspections and testings are undertaken at least every five years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations. A precautionary check of the electrical system is always recommended prior to purchase. No tests were carried out by this firm.

Gas	
Repair category	1
Notes	In the interests of safety and in light of recent regulations it would be prudent to have all gas appliances checked by a Gas Safe registered contractor.

Water, plumbing and bathroom fittings		
Repair category	1	
Notes	Seals at the en suite shower would benefit from re-sealing in order to ensure water tightness.	
	We presume the sealants around the sanitary fittings are functional and no defects are present to the adjacent areas. A precautionary check of the areas below and adjacent to the sanitary fittings is always recommended prior to purchase as these areas are prone to leakage.	

Heating and hot water		
Repair category	2	
Notes	The boiler is original to the construction of the house and future upgrading should be anticipated. Estimates are advised.	
	Staining beneath the hot water cylinder was found to be dry when tested.	
	It is assumed that the central heating system has been properly installed, updated and maintained to meet with all current regulations and standards with particular regard to fluing and ventilation requirements. Service records should be obtained and checked.	
	A precautionary check is always recommended prior to purchase. No tests have been carried out by this firm.	

Drainage	
Repair category	1
Notes	All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested. A precautionary check of the drainage system is always recommended
	prior to purchase. No tests were carried out by this firm.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	N/A
Roofing including roof space	2
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	N/A
Communal areas	N/A
Garages and permanent outbuildings	1
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	N/A
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	2
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Wherea lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?		Ground and First		
2. Are there three steps or fewer to a main entrance door of the property?	Yes	X	No	
3. Is there a lift to the main entrance door of the property?	Yes		No	X
4. Are all door openings greater than 750mm?	Yes		No	X
5. Is there a toilet on the same level as the living room and kitchen?	Yes	X	No	
6. Is there a toilet on the same level as a bedroom?	Yes	X	No	
7. Are all rooms on the same level with no internal steps or stairs?	Yes		No	X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes	X	No	

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The property has been extended to form the present accommodation and it should be confirmed all Local Authority documentation has been obtained. We understand that the extension has foundations to cater for a future first storey extension.

Rights of access, land ownership and maintenance liabilities should be confirmed through an inspection of the Title Deeds.

The property is situated in an area of past mining activity. A mining report should be obtained from the Coal Authority to provide information as to historic and future mining activity and whether the property has been the subject of any compensation claims and to confirm that the property is not adversely affected.

There may be a factoring charge for the upkeep of the residential estate.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £430,000 (FOUR HUNDRED AND THIRTY THOUSAND POUNDS STERLING).

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £400,000 (FOUR HUNDRED THOUSAND POUNDS STERLING).

Signed	Edward Cook Electronically signed :- 19/03/2024 10:33
Report author	Edward Cook

Company name	J & E Shepherd Chartered Surveyors
Address	187 North Street Musselburgh EH21 6AN
Date of report	13/03/2024



www.shepherd.co.uk

Property Address			
Address	32 Poplar Park, Port Seton, Prestonpans, EH32 0TD		
Seller's Name	Mr and Mrs Colin Sturrock		
Date of Inspection	13/03/2024		
December Datable			
Property Details			
Property Type X House	Bungalow Purpose built maisonette Converted maisonette		
Purpose built flat	Converted flat Tenement flat Flat over non-residential use		
Property Style X Detached	Semi detached Mid terrace End terrace		
Back to back	☐ High rise block ☐ Low rise block ☐ Other (specify in General Remarks)		
Does the surveyor believe that the	property was built for the public sector, e. g. local authority,		
military, police?	property was built for the public sector, o. g. losal additionly,		
Flats/Maisonettes only Floor(s) on whether the state of t			
Approximate Year of Construction	No. of units in block		
Tenure			
X Absolute Ownership	Other		
Accommodation			
Number of Rooms 2 Living room			
2 Bathroom(s	s) 1 WC(s) 1 Other (Specify in General remarks)		
Gross Floor Area (excluding garage	es and outbuildings) 142 m² (Internal) m² (External)		
Residential Element (greater than 4	0%) X Yes No		
Garage / Parking / Outbuildings			
X Single garage Double ga	rage Parking space No garage / garage space / parking space		
Available on site?	No		
Permanent outbuildings:			
None.			

Construction
Walls X Brick Stone Concrete Timber frame Other (specify in General Remarks) Roof X Tile Slate Asphalt Felt Other (specify in General Remarks)
Special Risks
Has the property suffered structural movement?
If Yes, is this recent or progressive?
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in \square Yes \boxtimes No the immediate vicinity?
If Yes to any of the above, provide details in General Remarks.
Service Connections
Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks
Drainage X Mains Private None Water X Mains Private None
Electricity X Mains Private None Gas X Mains Private None Central Heating X Yes Partial None
Brief description of Central Heating and any non mains services:
Gas fired to radiators.
Site
Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.
Rights of way Shared drives / access Garage or other amenities on separate site Shared service connections
Ill-defined boundaries Agricultural land included with property Other (specify in General Remarks)
Location
X Residential suburb Residential within town / city Mixed residential / commercial Shared service connections
Commuter village Remote village Isolated rural property Other (specify in General Remarks)
Planning Issues
Has the property been extended / converted / altered? X Yes No If Yes provide details in General Remarks.
Roads
X Made up road Unmade road Partly completed new road Pedestrian access only Adopted Unadopted

General Remarks

At the time of inspection the property was found to be in an order consistent with one of its age and type of construction.

The property has been extended to form the present accommodation and it should be confirmed all Local Authority documentation has been obtained. We understand that the extension has foundations to cater for a future first storey extension.

Rights of access, land ownership and maintenance liabilities should be confirmed through an inspection of the Title Deeds.

The property is situated in an area of past mining activity. A mining report should be obtained from the Coal Authority to provide information as to historic and future mining activity and whether the property has been the subject of any compensation claims and to confirm that the property is not adversely affected.

There may be a factoring charge for the upkeep of the residential estate.

The property further benefits from a utility room.

Ongoing maintenance and repairs should be anticipated to the external fabric of the building in accordance with good maintenance practice

	a so a mopaled to the external labile of the saliang		
Essential Repairs			
None.			
Estimated cost of essential repairs			
Retention recommended?	Yes X No		
Retention amount			
Comment on Mortgageability The property forms suitable security for respect to the property forms are suitable security for respect to the pr	mortgage purposes subject to the specific lending crit	teria of any mortgage provider.	
Valuation			
Market value in present condition		£	400,000
Market value on completion of ess		£	
Insurance reinstatement value		£	430,000
(to include the cost of total rebuilding,	, site clearance, professional fees, ancillary cha	arges plus VAT)	
Is a reinspection necessary?			Yes X No

Declaration

Signed Edward Cook

Electronically signed :- 19/03/2024 10:33

Surveyor's name Edward Cook

Professional qualifications MA (Hons), MSc, MRICS

Company name J & E Shepherd Chartered Surveyors

Address 187 North Street, Musselburgh, EH21 6AN

Telephone 0131 653 3456

Email Address musselburgh@shepherd.co.uk

Date of Inspection 13/03/2024



Energy Performance Certificate



Energy Performance Certificate (EPC)

Dwellings

Scotland

32 POPLAR PARK, PORT SETON, PRESTONPANS, EH32 0TD

Dwelling type:Detached houseDate of assessment:13 March 2024Date of certificate:13 March 2024

Total floor area: 142 m²

Primary Energy Indicator: 211 kWh/m²/year

Reference number: 9677-1005-4207-6244-1204 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, mains


gas

You can use this document to:

- . Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£6,153	See your recommendations report for more information
Over 3 years you could save*	£1,071	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

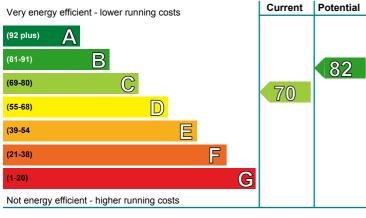


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (70)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

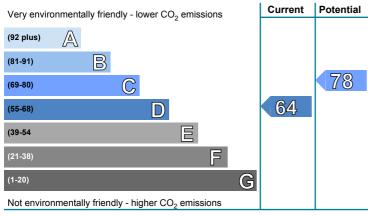

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (64)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Condensing boiler	£2,200 - £3,000	£573.00
2 Solar water heating	£4,000 - £6,000	£234.00
3 Replacement glazing units	£1,000 - £1,400	£267.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, insulated (assumed)	★★★★ ☆	★★★★☆
Roof	Pitched, 200 mm loft insulation Pitched, 250 mm loft insulation	**** ****	★★★★☆ ★★★★☆
Floor	Solid, limited insulation (assumed) Solid, insulated (assumed)	_ _	_ _
Windows	Fully double glazed	★★★☆☆	★★★☆☆
Main heating	Boiler and radiators, mains gas	****	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	****	★★★★☆
Secondary heating	Room heaters, mains gas	_	_
Hot water	From main system	****	★★★★☆
Lighting	Low energy lighting in all fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO_2 emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 37 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 5.3 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.0 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£4,797 over 3 years	£4,152 over 3 years	
Hot water	£867 over 3 years	£441 over 3 years	You could
Lighting	£489 over 3 years	£489 over 3 years	save £1,071
Totals	£6,153	£5,082	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

December ded massives		la disetiva sest	Typical saving	Rating after improvement	
Re	commended measures	Indicative cost per year		Energy	Environment
1	Replace boiler with new condensing boiler	£2,200 - £3,000	£191	C 72	D 68
2	Solar water heating	£4,000 - £6,000	£78	C 74	C 69
3	Replacement glazing units	£1,000 - £1,400	£89	C 75	C 71
4	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£541	B 82	C 78

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

Micro CHP

Choosing the right improvement package



For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

2 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

3 Replacement glazing units

Replacing existing double-glazed units with new high-performance units. Building regulations require that replacement glazing is to a standard no worse than previous; a building warrant is not required. Planning permission might be required for such work if a building is listed or within a conservation area so it is best to check with your local authority.

4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	13,642	N/A	N/A	N/A
Water heating (kWh per year)	2,840			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:
Assessor membership number:
Company name/trading name:
Address:

Mr. Edward Cook
EES/013614
J & E Shepherd
12 Atholl Crescent

Edinburgh EH3 8HA

Phone number: 0131 225 1234 Email address: edinburgh@shepherd.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





Property Questionnaire





Completion date of property questionnaire

property questionnaire

Property address	32 POPLAR PARK PORT SETON EAST LOTHIAN EH32 OTD
Sellers(s)	COLIN JAMES STURFOCK & PAMEUR JANE STURFOCK



Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale
 of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership	
	How long have you owned the property? 13 years 11 mon	ths ·
2.	Council tax	
	Which Council Tax band is your property in? (Please circle)	MANAGES I
	A B C D E F G H	
3.	Parking	
	What are the arrangements for parking at your property?	
	(Please tick all that apply)	
	• Garage	
	Allocated parking space	
	• Driveway	
	Shared parking	
	• On street	
	Resident permit	
	Metered parking	
	Other (please specify):	
4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes(No) Don't know

5.	Listed buildings	Yes/No
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	Yes/No
	If you have answered yes, please describe below the changes which you have made:	
	GROUND FLOOR EXTENSION TO THE SIDE & REAR. KITCHEN SIZE DOUBLED, NEW UTILITY ROOM & ADDITIONAL LIVING SPACE.	
	ADDITIONAL LIVING SPACE.	
i	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	Yes No
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	Yes/No
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes/No
	(ii) Did this work involve any changes to the window or door openings?	Yes/No
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):	.10.
		-
	Please give any guarantees which you received for this work to your solicitor or est	ate agent

7 .	Central heating	The state of the s				
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).					
	If you have answered yes or partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).					
	GAS FIRED					
	If you have answered yes, please answer the three questions below:					
	i) When was your central heating system or partial central heating system installed?	24 YEAR				
	(ii) Do you have a maintenance contract for the central heating system?	10				
	<u>If you have answered yes,</u> please give details of the company with which you have a maintenance contract:	Ye s √No				
		•				
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).					
8.						
8.	(Please provide the month and year).	Yes/No				
	(Please provide the month and year). Energy Performance Certificate Does your property have an Energy Performance Certificate which is less	Yes/No				
8. 9.	(Please provide the month and year). Energy Performance Certificate Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes/No				
9.	(Please provide the month and year). Energy Performance Certificate Does your property have an Energy Performance Certificate which is less than 10 years old? Issues that may have affected your property Has there been any storm, flood, fire or other structural damage to you property					
9. a.	(Please provide the month and year). Energy Performance Certificate Does your property have an Energy Performance Certificate which is less than 10 years old? Issues that may have affected your property Has there been any storm, flood, fire or other structural damage to you property while you have owned it? If you have answered yes, is the damage the subject of any outstanding	Yes/No				
9.	(Please provide the month and year). Energy Performance Certificate Does your property have an Energy Performance Certificate which is less than 10 years old? Issues that may have affected your property Has there been any storm, flood, fire or other structural damage to you property while you have owned it? If you have answered yes, is the damage the subject of any outstanding insurance claim? Are you aware of the existence of asbestos in your property?	Yes/No Yes/No				



	Commission	resetenti ilikussi, turi men			
	Services	Connected	Supplier	•	
	Gas or liquid petroleum gas		OCTOPUS	1	
	Water mains or private		SOMSH WATER	C	
	water supply		SCORNSH WATEL	2	
	Electricity		octopus)	
i	Mains drainage	$\sqrt{}$	SCOPPISH WATCH		
Telephone ST			BT		
	Cable TV or satellite		VIRGIN		
	Broadband		VIRGIN		
<u>lf y</u>	there a septic tank system at your provou have answered yes, please yes, please answered yes, please yes,	er the two questions k		Yes/No Yes/No Don't I	
<u>lf y</u>	Do you have a maintenance contract ou have answered yes, please give ove a maintenance contract:			Yes/No	

11.		
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?	Yes/No/ Don't Know
T - T - T - T - T - T - T - T - T - T -	If you have answered yes, please give details:	
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	Yes(No/) Not applicable
C.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	Yes(No
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:	Yes/No
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	Yes(No
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.) If you have answered yes, please give details:	Yes/No


12.	Charges associated with your property	
a.	Is there a factor or property manager for your property?	Yes/No
	If you have answered ves, please provide the name and address, and give details of any deposit held and approximate charges:	_
	JAMES GIBB PROPERTY MANAGEMENT	
	NO DEPOSIT	
	£132 annual see (payable quarterly)	
b.	Is there a common buildings insurance policy?	Yes(No/)
	If you have answered yes, is the cost of the insurance included in your	Don't Know
	monthly/annual factor's charges?	Yes/No/ Don't Know
	Please give details of any other charges you have to pay on a regular basis for the upker areas or repair works, for example to a residents' association, or maintenance or stair	
A. C. Tripper Communication Company of Communication Commu		
3 -	areas or repair works, for example to a residents' association, or maintenance or stair	
3.	areas or repair works, for example to a residents' association, or maintenance or stair	
A.S.E.	areas or repair works, for example to a residents' association, or maintenance or stair Continue	fund.
Adde	Specialist works As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the	fund.
Miss	Specialist works As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the	fund.
10.50	Specialist works As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the	fund.
	Specialist works As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the	fund.

b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?					Yes	/No
	If you have answered yes, please give details:						
c.	If you have answered yes to 13(a) or (b), do to this work?	o you have a	ny guaran	tees relatir	ng	Yes,	/No
	If you have answered yes, these guarantee and should be given to your solicitor as so do not have them yourself please write belyour solicitor or estate agent will arrange falso need to provide a description of the win the original estimate.	oon as possil low who has for them to b	ble for che these doc e obtained	ecking. If yo cuments an d. You will	ou nd		
	Guarantees are held by:						
14.							
a.	Are there any guarantees or warranties for	any of the fo	ollowing:				
(i).	Electrical work	No	Yes	Don't know	With ti deed	-	Lost
(ii).	Roofing	No	Yes	Don't know	With ti deed	itle Is	Lost
(iii).	Central heating	No	Yes	Don't know	With ti deed		Lost
(iv).	National House Building Council (NHBC)	No	Yes	Don't know	With ti deed		Lost
(v).	Damp course	No')	Yes	Don't know	With ti deed		Lost
(vi).	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With ti deed		Lost
b.	If you have answered 'yes' or 'with title dee installations to which the guarantee(s) rela		jive details	s of the wo	rk or		

c.	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details:	
To proprieta de la constanta d	NA	
15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	
	If you have answered yes , please give details:	
	NO	
16.	Notices that affect your property	
	In the past three years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Yes/No
b.	that affects your property in some other way?	Yes (No
c.	that requires you to do any maintenance, repairs or improvements to your property?	Yes/No
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this for knowledge and belief.			rue and correct to the best of my/our
Signature(s):	(Suw0(9)		CiA
	13/8/24		



Residential

Home Report

Mortgage & Re-Mortgage Valuation Home & Flat Buyer Report

Energy Performance Certificate (EPC)

Private Sale Valuation

Inheritance Tax Valuation

Capital Gains Tax Valuation

Separation Valuation

Driveby Valuation

Desktop Valuation

New Build, Development & Plot Valuation

Extension & Alteration Valuation

Portfolio Valuation

Rental Valuation

Expert Witness Report

Council Tax Appeal

Bespoke Condition Report

Commercial

Commercial Valuation

Commercial Agency

Acquisitions & Disposals

Commercial Lease Advisory

Rent Reviews

Asset Management

Project Consultancy

Development Appraisals

Elgin ▲ 01343 553939

△ 01324 635 999

Fraserburgh △ 01346 517456

△ 01896 750150

△ ▲ 0141 331 2807

Glasgow South

△ 0141 649 8020

Galashiels

Glasgow

Falkirk

Commercial Property Auctions

Property Management

Professional Services

Licensed Trade / Leisure

Glasgow West End

△ 0141 353 2080

Greenock △ 01475 730717

Hamilton △ 01698 897548

Inverness

△ ▲ 01463 712239

Kilmarnock

△ 01563 520318

Kirkcaldy △ 01592 205442

△ 01631 707 800 Paisley
△ 0141 889 8334

Oban

Property &

Quantity Surveying

Building Surveying

Principal Designer

Clerk of Works

Commercial EPC

Fire Engineering

Employer's Agent

Housing Services

Energy Department

Mediation Services

Livingston△ 01506 416777

△ 01674 676768

Motherwell △ 01698 252229

Musselburgh

△ 0131 653 3456

Montrose

Development Monitoring

Project Management

Construction

Health & Safety Management

Dispute Resolution Support Services

Perth

△ 01738 638188 ▲ 01738 631631

Peterhead ▲ 01779 470766

St Andrews

△ 01334 477773

▲ 01334 476469

Saltcoats △ 01294 464228

Stirling △ 01786 450438 ▲ 01786 474476

Aberdeen▲ ▲ 01224 202800

△ 01292 267987

Coatbridge △ 01236 436561

Cumbernauld △ 01236 780000

Dalkeith △ 0131 663 2780

Dumbarton △ 01389 731682

SHEPHERD

Dumfries▲ ▲ 01387 264333

Dundee

△ 01382 200454 ▲ 01382 220699

Dunfermline

▲ 01383 731841

East Kilbride

△ 01355 248535

Edinburgh △ 0131 2251234 ▲ 0131 557 9300

ShepherD



