

4B Ettrick Road, Merchiston Edinburgh EH10 5BJ 11/04/2024

- 1. Single Survey
- 2. Energy Report
- 3. Property Questionnaire

# survey report on:

Property address	4B Ettrick Road, Merchiston, Edinburgh, EH10 5BJ
Customer	Mr A Gorzalka & Mrs A Gorzalka
Customer address	4B Ettrick Road, Merchiston, Edinburgh, EH10 5BJ
Prepared by	J & E Shepherd
Date of inspection	8th April 2024



Tel: 0845 263 7995

www.shepherd.co.uk

#### **PART 1 - GENERAL**

#### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

Х

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

#### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

<sup>&</sup>lt;sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

#### 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
  or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

#### 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

#### 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

#### 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

<sup>&</sup>lt;sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

they assign the same to any other party in writing.

#### 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

#### 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

#### 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

#### 1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

#### PART 2 - DESCRIPTION OF THE REPORT

#### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

#### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

#### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

#### 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

#### 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

#### 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

#### 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

#### 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	Lower villa flat within a three storey block.
Accommodation	Ground Floor: Entrance hall, living room, kitchen/dining room, two bedrooms, shower room, wc compartment and wet room with shower.
Gross internal floor area (m²)	108m2 or thereby.
Neighbourhood and location	The subjects are situated in an established residential area of mixed style properties lying to the south of Edinburgh City Centre and convenient for all local amenities.
Age	144 years approx.
Weather	Dry and sunny.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate.
	The chimneys are of masonry construction. The chimneys were inspected from street level where seen.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.
	If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.

Roofing including roof space	The roof is pitched and slated with a flat platform. No access was afforded into the roof void area due to the access hatch being above a safe height. No access was afforded onto the flat roof covering.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	Cast iron gutters and downpipes.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls are built of traditional solid stone.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	The windows throughout are a mixture of single and double glazed style. The external doors are of timber variety.
External decorations	Visually inspected.
	Painted timber work.
Componentarios / morehos	W. H. J.
Conservatories / porches	Visually inspected.
	None.
Communal areas	
Communal areas	Circulation areas visually inspected.
	None.
Garages and permanent cuthuildings	Visually in spected
Garages and permanent outbuildings	Visually inspected.
	None.
Outside areas and boundaries	Visually inspected
Outside aleas allu poullualles	Visually inspected.
	There is garden ground to the front, side and rear of the property with a mixture of boundaries. There is a car driveway.

Ceilings	Visually inspected from floor level.
	Presumed plastered ceilings.
	r resumed plastered cellings.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Plaster finish.
Floors including sub floors	The flooring throughout is of suspended timber construction. No access was afforded into the sub floor areas.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The skirtings, facings, internal doors and kitchen units are of a timber variety.
Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	There is a fireplace within living room.
Internal decorations	Visually inspected.
	Papered and painted finish throughout.
	, aportos ana pantica milos sinos giros.
Cellars	Visually inspected where there was a safe and purpose-built access.
	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains supply.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.  Mains supply.

#### Water, plumbing, bathroom fittings

Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.

No tests whatsoever were carried out to the system or appliances.

Mains supply. Two piece suite within the shower room. Two piece suite within the wc compartment. Two piece suite and shower in the wet room. No access was afforded to the area below the sanitary fittings.

#### Heating and hot water

Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.

No tests whatsoever were carried out to the system or appliances.

The property has a gas fired boiler which appears to serve the central heating and hot water supply.

#### **Drainage**

Drainage covers etc were not lifted.

Neither drains nor drainage systems were tested.

To main public sewer.

#### Fire, smoke and burglar alarms

Visually inspected.

No tests whatsoever were carried out to the system or appliances.

All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership.

#### Any additional limits to inspection

For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

The property was fully floor covered and furnished throughout. No access was afforded in to the roof void area. No access was

#### Any additional limits to inspection

afforded into the sub floor areas. No access was afforded to the area below the sanitary fittings. The external fabric of the building was inspected from street level where seen.

An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.

### Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- 4 Flashing
- 5) Ridge ventilation
- 6) Ridge board
- 7) Slates / tiles
- (8) Valley guttering
- Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- 12) Sarking
- (13) Roof felt
- (14) Trusses
- 15) Collar
- (16) Insulation
- (17) Parapet gutter
- (18) Eaves guttering
- Rainwater downpipe
- 20) Verge boards/skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- (25) Window pointing
  - 6) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29) Bay window projection
- 30 Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33 Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- 37) Floor joists
- 38) Floorboards
- (39) Water tank
- 40 Hot water tank

#### 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	The property has suffered previous structural movement, however, this appears to be of a longstanding and non progressive nature and the risk of further movement taking place would appear unlikely given the limitations of a single visual survey.

Dampness, rot and infestation	
Repair category	1
Notes	Random damp meter readings were taken throughout using a moisture meter but no significant recordings were noted. For the purposes of this report we presume that those areas not inspected are free of defects.

Chimney stacks	
Repair category	1
Notes	Some areas of weathered masonry were noted. Ongoing maintenance should be anticipated and budgeted for in relation to the chimneys.

Roofing including roof space	
Repair category	2
Notes	Some loose and cracked slates were noted. We would recommend that a Roofing Contractor be instructed to carry out an inspection over the roof prior to purchase and provide estimates for any remedial works thereafter.  The flat roof covering could not be inspected and accordingly we cannot comment on its condition. It should be appreciated that this type of roof covering has a limited life span and that higher than average maintenance cost should be anticipated with eventual re-roofing being required.

Rainwater fittings	
Repair category	2
Notes	The rainwater goods are corroded in some areas. The rainwater goods should be monitored under a heavy downpour and any remedial works carried out thereafter.

Main walls	
Repair category	2
Notes	Some areas of weathered and damaged stone work were noted.

Windows, external doors and joinery	
Repair category	1
Notes	The windows are weathered in some areas. A precautionary check of all windows and doors is advised prior to purchase.

External decorations	
Repair category	1
Notes	The external paint work is showing signs of weathering.

Conservatories/porches	
Repair category	-
Notes	None.

Communal areas	
Repair category	-
Notes	None.

Garages and permanent outbuildings	
Repair category	-
Notes	None.

Outside areas and boundaries	
Repair category	2
Notes	The boundary walls are weathered and damaged in some areas and repair work should be anticipated and budgeted for in this area. A number of mature trees were noted in the garden ground and these should be closely monitored and any remedial works carried out thereafter.

Ceilings	
Repair category	1
Notes	No immediate action or repair is needed.

Internal walls	
Repair category	1
Notes	No immediate action or repair is needed.

Floors including sub-floors	
Repair category	1
Notes	Some areas of loose flooring were noted.

Internal joinery and kitchen fittings	
Repair category	1
Notes	It is presumed all glazed sections below 800mm are fitted with the appropriate safety glass.

Chimney breasts and fireplaces	
Repair category	1
Notes	All fireplaces, flues and chimney breasts should be checked and upgraded as necessary. It is presumed all blocked up fireplaces are appropriately vented.

Internal decorations	
Repair category	1
Notes	No immediate action or repair is needed.

Cellars	
Repair category	-
Notes	None.

Electricity	
Repair category	2
Notes	Dated fuseboard and electrics were noted. We would recommend an Electrician carry out an inspection over this area prior to purchase and provide estimates for remedial works thereafter.

Gas	
Repair category	1
Notes	No immediate action or repair is needed.

► Water, plumbing and bathroom fittings				
Repair category	1			
Notes	No access was afforded to the area below the sanitary fittings.			

Heating and hot water				
Repair category	1			
Notes	A precautionary check of the heating and hot water supply is advised.			

Drainage	
Repair category	1
Notes	No immediate action or repair is needed.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	-
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

#### Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

#### Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

#### Category 1

No immediate action or repair is needed.

#### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

#### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

#### 3. Accessibility information

#### Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes No X
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes X No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

#### 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

#### Matters for a solicitor or licensed conveyancer

During our inspection we noted the property had been altered and converted to provide the present accommodation and it is presumed all documentation was obtained at the time of conversion. The alterations would appear to be historic.

Where areas of maintenance, defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

#### Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £485,000 (Four Hundred and Eighty Five Thousand Pounds Sterling). This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

#### Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £690,000 (Six Hundred and Ninety Thousand Pounds Sterling).

Signed	Security Print Code [491593 = 8137 ] Electronically signed
Report author	Donal Henretty
Company name	J & E Shepherd
Address	12 Atholl Crescent, Edinburgh, EH3 8HA
Date of report	11th April 2024



Tel: 0845 263 7995

www.shepherd.co.uk

Property Address				
Address Seller's Name Date of Inspection	4B Ettrick Road, Mr A Gorzalka & 8th April 2024		burgh, EH10 5BJ	
Property Details				
Property Type	House Purpose built flat	Bungalow X Converted flat	Purpose built maison Tenement flat	nette Converted maisonette Flat over non-residential use Other (specify in General Remarks)
Property Style	Detached Back to back	Semi detached High rise block	Mid terrace X Low rise block	<ul><li>End terrace</li><li>Other (specify in General Remarks)</li></ul>
Does the surveyor be e.g. local authority, m		erty was built for	the public sector,	Yes X No
Flats/Maisonettes onl	y Floor(s) on which	located Ground	No. of floors in block	
Approximate Year of	Construction <sub>1880</sub>	)		
Tenure				
X Absolute Ownership	Leasehold	Ground rent £	Unexpire	d years
Accommodation				
Number of Rooms	1 Living room(s) 2 Bathroom(s)	2 Bedroom(s) 1 WC(s)	1 Kitchen(s) 0 Other (Specify in 0	General remarks)
Gross Floor Area (exc			108 m² (Internal)	m² (External)
Residential Element (	(greater than 40%)	X Yes No		
Garage / Parking /	Outbuildings			
Single garage Available on site?	Double garage X Yes No	X Parki	ng space	No garage / garage space / parking space
Permanent outbuildin	ıgs:			
None.				

Construction							
Walls	Brick	X Stone	Concrete	Timber frame	Other	(specify in Gen	eral Remarks)
Roof	Tile	X Slate	Asphalt	Felt	Other	(specify in Gen	eral Remarks)
Special Risks							
Has the property su	ffered structi	ural movement	?			X Yes	No
If Yes, is this recent	or progressi	ve?				Yes	X No
Is there evidence, h immediate vicinity?	istory, or rea	son to anticipa	te subsidence,	heave, landslip or	flood in the	Yes	X No
If Yes to any of the	above, provi	de details in Ge	eneral Remark	5.			
Service Connection	on						
Based on visual inspof the supply in Gen			s appear to be	non-mains, please	comment or	n the type ar	nd location
Drainage [	X Mains	Private	None	Water	X Mains	Private	None
Electricity	X Mains	Private	None	Gas	X Mains	Private	None
Central Heating [	X Yes	Partial	None				
Brief description of 0	Central Heat	ing:					
Gas fired central h	eating syste	m.					
Site							
Apparent legal issue	es to be verif	ied by the conv	vevancer Plea	se provide a brief (	description in	n General Re	emarks
Rights of way	Shared drive	, _	1	amenities on separate	·	ed service conn	
Ill-defined boundaries	_		al land included wit	•			neral Remarks)
Location							
Residential suburb	X Resi	dential within town	/ city Mixe	d residential / commerc	cial Mainl	y commercial	
Commuter village	Rem	ote village	Isola	ted rural property	Other	(specify in Ge	neral Remarks)
Planning Issues							
Has the property be	en extended	/ converted / a	altered? X	es No			
If Yes provide detail	s in General	Remarks.					
Roads							
X Made up road	Unmade road	Partly co	mpleted new road	Pedestrian ac	cess only	Adopted	Unadopted

General Remarks
During our inspection we noted the property had been altered and converted to provide the present accommodation and it is presumed all documentation was obtained at the time of conversion. The alterations would appear to be historic.
The property has suffered previous structural movement, however, this appears to be of a longstanding and non progressive nature and the risk of further movement taking place would appear unlikely given the limitations of a single visual survey.
Ongoing maintenance should be anticipated and budgeted for in relation to the internal and external fabric of the building.
Essential Repairs
None.
Estimated cost of essential repairs £ Retention recommended? Yes X No Amount £

Comment on Mortgageability					
The property forms suitab mortgage provider.	le security for mortgage purposes subject to the specific lending criteria o	f any			
Valuations					
Market value in present cor	ndition	£ 690,000			
Market value on completion	of essential repairs	£			
Insurance reinstatement va		£ 485,000			
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)					
Is a reinspection necessary	?	Yes X No			
Buy To Let Cases					
What is the reasonable rangementh Short Assured Tenal	ge of monthly rental income for the property assuming a letting on a 6 ncy basis?	£			
Is the property in an area w	here there is a steady demand for rented accommodation of this type?	Yes No			
Declaration					
Signed	Security Print Code [491593 = 8137] Electronically signed by:-				
Surveyor's name	Donal Henretty				
Professional qualifications	BLE MRICS				
Company name	J & E Shepherd				
Address	12 Atholl Crescent, Edinburgh, EH3 8HA				
Telephone 0131 225 1234					
Fax 0131 220 3178					
Report date	11th April 2024				

# **Energy Performance Certificate (EPC)**

**Dwellings** 

# **Scotland**

#### 4B ETTRICK ROAD, MERCHISTON, EDINBURGH, EH10 5BJ

**Dwelling type:** Ground-floor flat Date of assessment: 08 April 2024 Date of certificate: 11 April 2024 **Total floor area:** 108 m<sup>2</sup>

**Primary Energy Indicator:** 388 kWh/m<sup>2</sup>/year Reference number: 0190-2878-9040-2904-4805 RdSAP, existing dwelling Type of assessment:

**Approved Organisation: Elmhurst** 


Main heating and fuel: Boiler and radiators, mains

#### You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£8,346	See your recommendations
Over 3 years you could save*	£1,449	report for more information

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

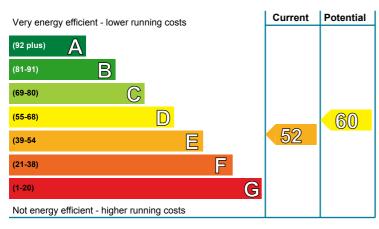


#### **Energy Efficiency Rating**

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is band E (52). The average rating for EPCs in Scotland is band D (61).

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

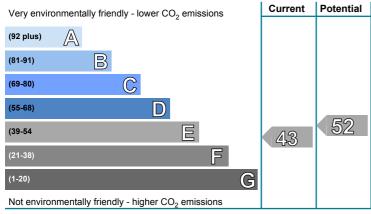

#### **Environmental Impact (CO<sub>2</sub>) Rating**

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is band E (43). The average rating for EPCs in Scotland is band D (59).

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

### Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£1008.00
2 Floor insulation (suspended floor)	£800 - £1,200	£441.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE **DWELLING AND NOT BE REMOVED UNLESS IT IS** REPLACED WITH AN UPDATED CERTIFICATE

#### Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	***	***
Roof	Pitched, no insulation (assumed)	****	***
Floor	Suspended, no insulation (assumed)	_	_
Windows	Partial double glazing	***	***
Main heating	Boiler and radiators, mains gas	<b>★★★★</b> ☆	<b>★★★</b> ☆
Main heating controls	Programmer, room thermostat and TRVs	<b>★★★★</b> ☆	<b>★★★</b> ☆
Secondary heating	None	_	_
Hot water	From main system	<b>★★★★</b> ☆	<b>★★★</b> ☆
Lighting	Low energy lighting in all fixed outlets	****	****

### The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

### The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 69 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 7.4 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.4 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

#### Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£7,377 over 3 years	£5,928 over 3 years	
Hot water	£546 over 3 years	£546 over 3 years	You could
Lighting	£423 over 3 years	£423 over 3 years	save £1,449
Total	£8,346	£6,897	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

#### Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

December ded massives	Indiantive and	Typical saving	Rating after improvement	
Recommended measures	indicative cost	Indicative cost per year		Environment
1 Internal or external wall insulation	£4,000 - £14,000	£336	D 58	E 49
2 Floor insulation (suspended floor)	£800 - £1,200	£147	D 60	E 52

### Choosing the right improvement package



For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

#### About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

#### 1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

#### 2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

#### Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

#### Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	27,238	(9,814)	N/A	(4,357)
Water heating (kWh per year)	2,130			

#### Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

#### **About this document**

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:
Assessor membership number:
Company name/trading name:
Address:

Mr. Donal Henretty
EES/013000
J & E Shepherd
13 Albert Square

Dundee DD1 1XA

Phone number: 01382 200454

Email address: dundee@shepherd.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

#### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

#### Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



# **Property Questionnaire**

Property Address	4B Ettrick Road, Merchiston
	Edinburgh
	EH10 5BJ

Seller(s)	Mr Andrew Gorzalka
	Mrs Agnes Gorzalka

Completion date of property questionnaire	01/04/2024
---	------------

1	Length of ownership How long have you owned the property? 40				
2	Council tax Which Council Tax band is your property in? G				
3	Parking   What are the arrangements for parking at your property?   (Please tick all that apply)   Garage   □   Allocated parking space   Driveway ☑   Shared parking   On street □   Resident permit □   Metered parking □   Other (please specify)				
4	Conservation area Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)? Yes				
5	<b>Listed buildings</b> Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)? Yes				
<b>6</b> a.(i)	Alterations/additions/extensions  During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?  Yes  If you have answered yes, please describe below the changes which you have made:				
(ii)	Fitted wet room Did you obtain planning permission, building warrant, completion certificate and other consents for this work? Yes				
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.  If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:				

b. Have you had replacement windows, doors, patio doors or double glazing installed in your property?

Yes

If you have answered yes, please answer the three questions below:

(i) Were the replacements the same shape and type as the ones you replaced? Yes

(ii) Did this work involve any changes to the window or door openings?

(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):

Bedroom and Kitchen/Diner windows were replaced with Timber Sash and Case double glazed windows by Burgh Glazing Ltd, in November 2021. Front living room windows were not replaced.

Please give any guarantees which you received for this work to your solicitor or estate agent.

#### 7 Central heating

a. Is there a central heating system in your property?

(Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).

Yes

If you have answered yes or partial — what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).

Combi-boiler, gas-fired central heating.

If you have answered yes, please answer the three questions below:

(i) When was your central heating system or partial central heating system installed? Gas connected to the property in 2005 and gas-fired central heating system installed. New boiler installed 2019 by Scott Findlay Plumbing and Heating Ltd.

(ii) Do you have a maintenance contract for the central heating system?

Yes

If you have answered yes, please give details of the company with which you have a maintenance contract:

Scott Findlay Plumbing and Heating Ltd

(iii) When was your maintenance agreement last renewed? (Please provide the month and year).

03/2024

### **8 Energy Performance Certificate**

Does your property have an Energy Performance Certificate which is less than 10 years old?

No

### 9 Issues that may have affected your property

a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

b. Are you aware of the existence of asbestos in your property?

No

If you have answered yes, please give details:

#### 10 **Services**

Please tick which services are	connected to vour	property and	give details	of the supplier:
		p p - c , - c c.	9	

**Connected Supplier Services** Gas or liquid petroleum gas  $\overline{\mathbf{A}}$ Sainsburys Water mains or private water supply  $\sqrt{}$ Scottish Water Electricity  $\overline{\mathbf{A}}$ Sainsburys Scottish Water Mains drainage  $\mathbf{\Lambda}$  $\mathbf{\Lambda}$ Vodafone Telephone

Cable TV or satellite 

Broadband  $\mathbf{\Lambda}$ Vodafone

b. Is there a septic tank system at your property?

- (i) Do you have appropriate consents for the discharge from your septic tank?
- Do you have a maintenance contract for your septic tank? (ii)

If you have answered yes, please give details of the company with which you have a maintenance contract:

#### 11 Responsibilities for shared or common areas

Are you aware of any responsibility to contribute to the cost of anything used jointly, such as a. the repair of a shared drive, private road, boundary, or garden area? No

If you have answered yes, please give details:

b. Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?

Yes

If you have answered yes, please give details:

We pay 1/4 towards maintaining the main roof of the building.

Has there been any major repair or replacement of any part of the roof during the time you C. have owned the property?

Yes

d. Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?

No

If you have answered yes, please give details:

As far as you are aware, do any of your neighbours have the right to walk over your e. property, for example to put out their rubbish bin or to maintain their boundaries? No

If you have answered yes, please give details:

f. As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)

No

If you have answered yes, please give details:

#### 12 Charges associated with your property

a. Is there a factor or property manager for your property?

No

b. Is there a common buildings insurance policy?

No

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

c. Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.

The connection to the main drain for the street runs under our boundary (access to which is by the front gate).

#### 13 Specialist works

a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?

Yes

If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.

In 2013, Edinburgh Roofing Services renewed rubber bond between main wall and 4b's roof and pointing work done to the building under 4b's roof, as well as extensive replacement leading to roof (guaranteed for 20 years).

b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?

No

If you have answered yes, please give details:

c. If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate., these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

Guarantees are held by:

#### 14 Guarantees

- a. Are there any guarantees or warranties for any of the following:
- (i) Electrical work

No

(ii) Roofing

Yes

(iii) Central heating

Yes

(iv) National House Building Council (NHBC)

No

(v) Damp course

No

(vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)

No

- b. <u>If you have answered 'yes'</u> or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):
- (i) Electrical work
- (ii) Roofing

Edinburgh Roofing Services Ltd check 4b's roof annually

(iii) Central heating

Scott Findlay Plumbing and Heating Ltd check the boiler annually to maintain the 10 year warranty

- (iv) National House Building Council (NHBC)
- (v) Damp course
- (vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)
- c. Are there any outstanding claims under any of the guarantees listed above?

No

If you have answered yes, please give details:

#### 15 Boundaries

So far as your are aware, has any boundary of your property been moved in the last 10 years?

No

If you have answered yes, please give details:

### 16 Notices that affect your property

In the past three years have you ever received a notice:

- a. advising that the owner of a neighbouring property has made a planning application? Yes
- b. that affects your property in some other way?

No

c. that requires you to do any maintenance, repairs or improvements to your property?

If you have answered yes to any of a–c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.