

HARVEY DONALDSON & GIBSON

CHARTERED SURVEYORS

Parent to HomeReportScotland.scot





- 1. Single Survey
- 2. Energy Report
- 3. Property Questionnaire

survey report on:

Property address	22 Kenmure Gardens, Bishopbriggs, Glasgow, G64 2BX
Customer	Ms M Frew
Customer address	22 Kenmure Gardens, Bishopbriggs, Glasgow, G64 2BX
Prepared by	Harvey Donaldson And Gibson
Date of inspection	12th October 2023



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

Х

The ultimate holding company of Harvey Donaldson & Gibson is Countrywide plc. In Scotland, Countrywide plc also own Slater Hogg & Howison and Countrywide North. A full list of estate agents owned or under franchise to Countrywide plc is available on request. Harvey Donaldson & Gibson trades as an entirely separate company and has no financial interest whatsoever in the disposal of the property being inspected.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
 or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information

contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be

researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.


Description	Two storey purpose built end terraced house dating from circa 1935 with single storey rear extension added circa 1988.
Accommodation	Ground Floor: Entrance hall, living room, kitchen, dining room, single bedroom/home office.
	First Floor: 2 bedrooms and bathroom.
Gross internal floor area (m²)	74.
Neighbourhood and location	Established and popular residential suburban area of similar style housing, considered convenient for services and amenities.
Age	88 years old.
Weather	Dry and sunny.
Chimney stacks	Chimney head removed and replaced with metal flue liners.
Roofing including roof space	Pitched, timber supported and concrete tile clad roof. The extension roof is flat and clad with felt overlaid with a rubberised coating.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	PVC and cast iron components.

Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls are brick cavity construction finished in render.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	The windows are PVCu framed and double glazed. External entrance doors are double glazed. The eaves are timber clad.
External decorations	Visually inspected.
	Painted metal, joinery and PVCu finishes.
Conservatories / porches	None.
Communal areas	None.
Garages and permanent outbuildings	No permanent outbuildings – timber garden shed only.
Outside areas and boundaries	Visually inspected.
	The property benefits from private gardens to the front, side and rear.
Ceilings	Visually inspected from floor level.
	Lath and plaster construction.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	The internal walls and partitions are plastered masonry and plasterboard.
L.	

Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
	Suspended timber floors.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The kitchen is fitted with wall and base units. Internal doors, skirting and facings are timber/fibreboard.
Chimney breasts and fireplaces	Visually inspected
Cililiney breasts and ineplaces	Visually inspected. No testing of the flues or fittings was carried out.
	Fireplaces have been removed/blocked.
Internal decorations	Visually inspected.
	A mixture of paper, paint, Artex/texture and tile finishes.
Cellars	None.
Flactoriation	
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains connected.
Coo	
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains connected.

Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	A mains water supply is connected.
	1
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	Gas-fired central heating system with modern condensing combination boiler providing hot water.
Drainage	Drainage covers etc were not lifted.
	Neither drains nor drainage systems were tested.
	The property is believed to be connected to mains drainage.
Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	Scottish government regulations came into effect in February 2022 which requires each property to have linked smoke and heat detectors and if gas/carbon burning appliances are present then a carbon monoxide alarm fitted. Upgrading is required to comply with these regulations. Purchasers should satisfy themselves with regards to compliance.
Any additional limits to inspection	The property was inspected within the limits imposed by fully fitted floor coverings. Floor coverings were not lifted and no sub floor timbers have been inspected. We have not inspected below the bath or below kitchen fittings. It will be appreciated that parts of the property which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defects.
	This report does not include an asbestos inspection. Asbestos was widely used in the building industry until around 2000, when it became a banned substance. The possibility of asbestos based products have been reported within the limitations of the inspection. If you have concerns you should engage a qualified asbestos surveyor.
	It was dry on the date of inspection. Leakage, condensation, failed double glazed seals and water penetration within roof spaces, around window openings, rainwater goods, below flat roofs etc are usually only visible during adverse weather conditions.

Sectional Diagram showing elements of a typical house

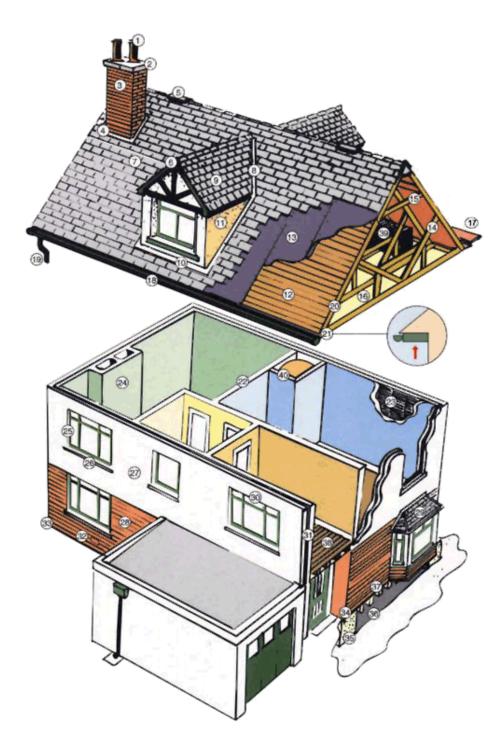

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6 Ridge board
- 7) Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- (12) Sarking
- (13) Roof felt
- (14) Trusses
- 15) Collar
- 16) Insulation
- 17) Parapet gutter
- 18) Eaves guttering
- 19) Rainwater downpipe
- 20) Verge boards/skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- 25) Window pointing
- 6) Window sills
- 27) Rendering
- 28) Brickwork / pointing
- 29) Bay window projection
- 30 Lintels
- 31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33) Damp proof course
- 34) Base course
- 35) Foundations
- (36) Solum
- 37) Floor joists
- 38) Floorboards
- 39) Water tank
- 40 Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	No visible evidence of significant structural movement was noted within the limitations of the inspection. All buildings move daily and seasonally as a result of external factors such as gravity, temperature, moisture content and vibrations. Consequently most buildings will have minor non structural cracks related to these factors. Minor cracks can be filled during normal redecoration but often recur seasonally due to normal movement in a building. Non structural cracks of this nature will not be recorded or reported.

Dampness, rot and infestation	
Repair category	1
Notes	Some condensation readings were noted in the extension. Additional heating and ventilation should help to reduce condensation levels.

Chimney stacks	
Repair category	-
Notes	N/A.

Roofing including roof space	
Repair category	2
Notes	Mortar pointing at roof ridge and hip tiling has deteriorated with cracked mortar and gaps noted. Pointing repairs should be anticipated. The flat roof covering is blistered in places which is a sign that it is coming to the end of its performance life. The flat roof is uneven known as ponding. It should be noted that flat roof coverings have a short life expectancy and generally require higher than average levels of maintenance.

Rainwater fittings	
Repair category	1
Notes	No significant defects requiring immediate repair were noted to the rainwater fittings however; it was not raining at the time of the inspection to confirm if the rainwater goods are watertight.

Main walls	
Repair category	1
Notes	No significant defects requiring immediate repair. The render is affected by some cracking typical for a property of this age. Future maintenance should be anticipated.

Windows, external doors and joinery	
Repair category	1
Notes	All windows and external entrance doors were opened and are operating normally. Most of the windows have no vents.

External decorations	
Repair category	1
Notes	No significant defects requiring immediate repair.

Conservatories/porches	
Repair category	-
Notes	N/A.

Communal areas	
Repair category	-
Notes	N/A.

Garages and permanent outbuildings	
Repair category	-
Notes	N/A.

Outside areas and boundaries	
Repair category	2
Notes	The rear garden is sloped necessitating the use of garden dwarf retaining walls. At present these appeared in order but future maintenance should be anticipated as they are off plumb and cracked.

Ceilings	
Repair category	1
Notes	No significant defects requiring immediate repair. As age increases, it is not unusual for the plaster to lose its key with the timber lathing, and such defects are only revealed when decorative surfaces are stripped to allow redecoration to take place.

Internal walls	
Repair category	1
Notes	No obvious significant defects were noted to internal walls and partitions.

Floors including sub-floors	
Repair category	1
Notes	Within the limitations imposed by fully fitted floor coverings, no significant defects requiring immediate repair were noted. Floor coverings were not lifted and sub floor timbers were not exposed.

Internal joinery and kitchen fittings	
Repair category	1
Notes	No significant defects requiring immediate repair.

Chimney breasts and fireplaces	
Repair category	-
Notes	N/A.

Internal decorations	
Repair category	1
Notes	Internal decoration is fresh throughout. Some Artex/texture finishes are present. Some pre 2000 Artex/texture finishes have been known to contain asbestos fibres. A finish of this type is not normally considered a health hazard as any asbestos fibres would be encapsulated by the material however if any disruption or disposal is contemplated in the future it should be carried out by a licensed asbestos contractor.

Cellars	
Repair category	-
Notes	N/A.

3
We noted no evidence of any recent test certification. It is recommended good practice that all electrical installations should be checked periodically, at least every ten years or when a property changes hands. This should be regarded as a routine safety and maintenance check. It should be appreciated that only the most recently re-wired and certified or constructed properties will comply with current regulations and some upgrading will be likely. The consumer unit has re-wireable fuses which do not conform to current standards. Upgrading and/or renewal should be anticipated.

Gas	
Repair category	1
Notes	No obvious significant defects noted. In the absence of test documentation being exhibited, all gas appliances should be tested soon after purchase and thereafter regularly maintained by a Gas Safe registered contractor.

Water, plumbing and bathroom fittings			
Repair category	1		
Notes	Sanitary fittings appeared serviceable but have not been tested.		

Heating and hot water			
Repair category	1		
Notes	A modern boiler has been installed. All documentation and guarantees relating to the installation of the new boiler should be retained for future reference. It should be confirmed that the system was commissioned/tested by a Gas Safe engineer and serviced if appropriate.		

Drainage	
Repair category	1
Notes	No significant defects requiring immediate repair.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	2
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	-
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	3
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground floor
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes No X
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes No X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The tenure is assumed to be outright ownership and this should be confirmed. In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal. The ownership details, Land Certificate or plot boundaries have not been checked by the surveyor.

Where defects or repairs have been identified within this report, regardless of whether reported as category 1, 2 or 3 (please read category definitions), or where access was not possible to parts of the structure, prior to entering into any legally binding sale or purchase contract, further specialists and/or contractors advice and estimates must be obtained by the purchaser, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

The property is situated in an area of mining activity. Legal adviser to obtain a mining report from the coal authority. It is assumed no adverse matters will be revealed by the report.

The property has been extended circa 1988. The valuation is given on the assumption that certification in respect of the planning permissions, building warrants and completion certificates were issued for these works. It should be established if any maintenance access rights are in place to access the neighbours garden to maintain the rear mutual extension wall.

Estimated reinstatement cost for insurance purposes

£230,000 (Two hundred and thirty thousand pounds).

Building costs are currently increasing significantly above inflation due to material and labour shortages. It is recommended that you update this figure regularly to ensure that you have adequate cover or alternatively seek specialist advice from your insurer.

Valuation and market comments

In its present condition the opinion of valuation for the Outright Ownership interest with vacant possession on the 12th October 2023 is £240,000 (Two hundred and forty thousand pounds).

Signed	Security Print Code [499718 = 8173] Electronically signed				
Report author	Darren Nouillan				
Company name	Harvey Donaldson And Gibson				

Address	Suite 3/7 Standard Buildings, 94 Hope Street, Glasgow, G2 6PH				
Date of report	17th October 2023				



Property Address						
Address Seller's Name Date of Inspection	22 Kenmure Gardens, Bishopbriggs, Glasgow, G64 2BX Ms M Frew ion 12th October 2023					
Property Details						
Property Type	X House Bungalow Purpose built maisonette Converted maisonette Purpose built flat Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)					
Property Style	□ Detached X Semi detached □ Mid terrace □ End terrace □ Back to back □ High rise block □ Low rise block □ Other (specify in General Remarks)					
Does the surveyor be e.g. local authority, m	elieve that the property was built for the public sector, Yes X No nilitary, police?					
Flats/Maisonettes only						
Approximate Year of	No. of units in block Construction 1935					
Tenure						
X Absolute Ownership	Leasehold Ground rent £ Unexpired years					
Accommodation						
Number of Rooms	2 Living room(s) 3 Bedroom(s) 1 Kitchen(s) 1 Bathroom(s) 0 WC(s) 0 Other (Specify in General remarks)					
Gross Floor Area (exc	cluding garages and outbuildings) 74 m² (Internal) 85 m² (External)					
Residential Element ((greater than 40%) X Yes No					
Garage / Parking /	Outbuildings					
Single garage Available on site?	□ Double garage X Parking space □ No garage / garage space / parking space X Yes □ No					
Permanent outbuildin	igs:					
None.						

Construction								
Walls	X Brick	Stone	Concrete	Timber frame	Other	(specify in Ger	neral Remarks)	
Roof	X Tile	Slate	Asphalt	Felt	Other	Other (specify in General Remarks		
Special Risks								
Has the property s	uffered struct	ural movement	?			Yes	X No	
If Yes, is this recer	nt or progress	ive?				Yes	No	
Is there evidence, immediate vicinity?		ason to anticipa	te subsidence	heave, landslip o	r flood in the	Yes	X No	
If Yes to any of the	above, provi	de details in G	eneral Remark	S.				
Service Connec	tion							
Based on visual in of the supply in Ge			s appear to be	non-mains, please	e comment o	n the type a	nd location	
Drainage	X Mains	Private	None	Water	X Mains	Private	None	
Electricity	X Mains	Private	None	Gas	X Mains	Private	None	
Central Heating	X Yes	Partial	None					
Gas central heat			ding hot water.					
Site								
Apparent legal issu	ues to be veri	fied by the con	veyancer. Plea	se provide a brief	description in	n General R	emarks.	
Rights of way	Shared drive	es / access	Garage or other	amenities on separate	site Share	ed service conr	nections	
Ill-defined boundari	es	Agricultura	al land included wit	h property	Othe	r (specify in Ge	neral Remarks)	
Location								
X Residential suburb	Res	idential within towr	n / city Mixe	d residential / commer	cial Mainl	ly commercial		
Commuter village	Ren	note village	Isola	ted rural property	Other	r (specify in Ge	neral Remarks)	
Planning Issues								
Has the property been extended / converted / altered? X Yes No								
If Yes provide deta	ils in Genera	Remarks.						
Roads								
X Made up road	Unmade road	Partly co	mpleted new road	Pedestrian a	ccess only	Adopted	Unadopted	

General Remarks
Although maintenance and repairs are required, no defects were noted that would adversely affect the property as a mortgage security. The maintenance and repairs required should be costed by the purchaser prior to purchase commitment.
The property is situated in an area of mining activity. Legal adviser to obtain a mining report from the coal authority. It is assumed no adverse matters will be revealed by the report.
The property has been extended circa 1988. The valuation is given on the assumption that certification in respect of the planning permissions, building warrants and completion certificates were issued for these works. It should be established if any maintenance access rights are in place to access the neighbours garden to maintain the rear mutual extension wall.
Essential Repairs
Although maintenance and repairs are required, no defects were noted that would adversely affect the property as a mortgage security.
as a mortgage security.
Estimated cost of essential repairs £ Retention recommended?Yes No Amount £

Comment on Mortgagea	bility	
The property is considered criteria.	d suitable for mortgage purposes in present condition subject to individua	l lenders
Valuations		
Market value in present cor Market value on completion Insurance reinstatement va (to include the cost of total Is a reinspection necessary	n of essential repairs lue rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£ 240,000 £ 230,000
Buy To Let Cases		
month Short Assured Tenan Is the property in an area w	ge of monthly rental income for the property assuming a letting on a 6 ncy basis? There there is a steady demand for rented accommodation of this type?	£ Yes No
Declaration Signed	Security Print Code [499718 = 8173]	
Surveyor's name Professional qualifications	Electronically signed by:- Darren Nouillan MRICS	
Company name Address Telephone	Harvey Donaldson And Gibson Suite 3/7 Standard Buildings, 94 Hope Street, Glasgow, G2 6PH 01332 813 031	
Fax Report date	0203 880 9193 17th October 2023	

Energy Performance Certificate (EPC)

Dwellings

Scotland

22 KENMURE GARDENS, BISHOPBRIGGS, GLASGOW, G64 2BX

Dwelling type: End-terrace house
Date of assessment: 12 October 2023
Date of certificate: 12 October 2023

Total floor area: 74 m²

Primary Energy Indicator: 264 kWh/m²/year

Reference number: 9190-2432-5100-2297-1655 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, mains


gas

You can use this document to:

- . Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£5,370	See your recommendations
Over 3 years you could save*	£1,329	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

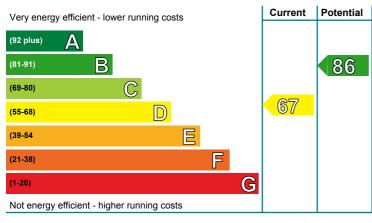


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (67)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

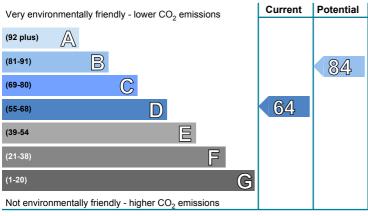

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (64)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Cavity wall insulation	£500 - £1,500	£681.00
2 Floor insulation (suspended floor)	£800 - £1,200	£423.00
3 Solar water heating	£4,000 - £6,000	£222.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed) Cavity wall, as built, insulated (assumed)	***** ****	**** ****
Roof	Pitched, 75 mm loft insulation Flat, insulated (assumed)	***** ***	**** ***
Floor	Suspended, no insulation (assumed)	_	_
Windows	Fully double glazed	****	★★★ ☆
Main heating	Boiler and radiators, mains gas	****	****
Main heating controls	Programmer, room thermostat and TRVs	****	****
Secondary heating	None	_	_
Hot water	From main system	****	****
Lighting	Low energy lighting in all fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 47 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 3.4 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.8 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£4,338 over 3 years	£3,231 over 3 years	
Hot water	£675 over 3 years	£453 over 3 years	You could
Lighting	£357 over 3 years	£357 over 3 years	save £1,329
Totals	£5,370	£4,041	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

December ded messages		Indicative cost	Typical saving	Rating after improvement	
Re	commended measures	Indicative cost	per year	Energy	Environment
1	Cavity wall insulation	£500 - £1,500	£227	C 71	C 69
2	Floor insulation (suspended floor)	£800 - £1,200	£141	C 73	C 72
3	Solar water heating	£4,000 - £6,000	£74	C 74	C 74
4	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£596	B 86	B 84

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

External insulation with cavity wall insulation

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	11,208	(453)	(2,018)	N/A
Water heating (kWh per year)	1,947			

Recommendations Report

Addendum

This dwelling may be exposed to wind driven rain and so requires further investigation to determine which type of cavity wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Darren Nouillan

Assessor membership number: EES/016071

Company name/trading name: Harvey Donaldson & Gibson Chartered Surveyors Address:

Suite 3/7 Standard Buildings 94 Hope Street

Glasgow G2 6PH

0141 2040808 Phone number:

frances.wilson@hdg.co.uk Email address:

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



Property Questionnaire

Property Address	22 Kenmure Gardens
	Bishopbriggs
	GLASGOW
	G64 2BX

Seller(s)	Ms Margaret Frew
-----------	------------------

Completion date of property questionnaire	10/10/2023
---	------------

1	Length of ownership How long have you owned the property? 47 years
2	Council tax Which Council Tax band is your property in?
3	Parking What are the arrangements for parking at your property? (Please tick all that apply) Garage □ Allocated parking space Driveway ☑ Shared parking On street ☑ Resident permit □ Metered parking □ Other (please specify)
4	Conservation area Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)? No
5	Listed buildings Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)? No
6 a.(i)	Alterations/additions/extensions During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? Yes If you have answered yes, please describe below the changes which you have made:
(ii)	Ground floor extension Did you obtain planning permission, building warrant, completion certificate and other consents for this work? Yes
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:

b. Have you had replacement windows, doors, patio doors or double glazing installed in your property?

Yes

If you have answered yes, please answer the three questions below:

(i) Were the replacements the same shape and type as the ones you replaced? Yes

(ii) Did this work involve any changes to the window or door openings?

(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):

New windows and back door 2015

Please give any guarantees which you received for this work to your solicitor or estate agent.

7 Central heating

a. Is there a central heating system in your property?

(Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).

Yes

If you have answered yes or partial — what kind of central heating is there?

(Examples: gas-fired, solid fuel, electric storage heating, gas warm air).

Gas fired

If you have answered yes, please answer the three questions below:

(i) When was your central heating system or partial central heating system installed? New boiler 6 years ago

(ii) Do you have a maintenance contract for the central heating system?

Yes

If you have answered yes, please give details of the company with which you have a maintenance contract:

FJHN plumbing solutions

(iii) When was your maintenance agreement last renewed?

(Please provide the month and year).

06/2021

8 Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old?

No

9 Issues that may have affected your property

a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

b. Are you aware of the existence of asbestos in your property?

No

If you have answered yes, please give details:

10 Services

Please tick which services are connected to your property and give details of the supplier:

Services **Connected Supplier** $\overline{\mathbf{V}}$ Scottish power Gas or liquid petroleum gas Water mains or private water supply $\overline{\mathbf{Q}}$ Council $\overline{\mathbf{A}}$ Electricity Scottish power Mains drainage $\overline{\mathsf{V}}$ Council $\overline{\mathbf{A}}$ Telephone Virgin Cable TV or satellite $\overline{\mathbf{V}}$ Virgin Broadband $\overline{\mathsf{V}}$ Virgin

b. Is there a septic tank system at your property?

No

- (i) Do you have appropriate consents for the discharge from your septic tank?
- (ii) Do you have a maintenance contract for your septic tank?

If you have answered yes, please give details of the company with which you have a maintenance contract:

11 Responsibilities for shared or common areas

 Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?

If you have answered yes, please give details:

b. Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?

Not applicable

If you have answered yes, please give details:

c. Has there been any major repair or replacement of any part of the roof during the time you have owned the property?

Yes

d. Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?

No

If you have answered yes, please give details:

e. As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?

If you have answered yes, please give details:

f. As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)

No

If you have answered yes, please give details:

12 Charges associated with your property

a. Is there a factor or property manager for your property?

No

b. Is there a common buildings insurance policy?

Yes

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

No

c. Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.

N/A

13 Specialist works

a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?

No

If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.

b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?

No

If you have answered yes, please give details:

c. If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate., these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

Guarantees are held by:

14 Guarantees

- a. Are there any guarantees or warranties for any of the following:
- (i) Electrical work

No

(ii) Roofing

No

(iii) Central heating

No

(iv) National House Building Council (NHBC)

No

(v) Damp course

No

(vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)

No

- b. <u>If you have answered 'yes'</u> or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):
- (i) Electrical work
- (ii) Roofing
- (iii) Central heating
- (iv) National House Building Council (NHBC)
- (v) Damp course
- (vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)
- c. Are there any outstanding claims under any of the guarantees listed above?

If you have answered yes, please give details:

15 Boundaries

So far as your are aware, has any boundary of your property been moved in the last 10 years?

No

If you have answered yes, please give details:

16 Notices that affect your property

In the past three years have you ever received a notice:

- a. advising that the owner of a neighbouring property has made a planning application?
 No
- b. that affects your property in some other way?
- c. that requires you to do any maintenance, repairs or improvements to your property?

If you have answered yes to any of a–c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.