

3 Orchardfield Avenue, Corstorphine Edinburgh EH12 7SX 28/03/2024

- 1. Single Survey
- 2. Energy Report
- 3. Property Questionnaire

# survey report on:

| Property address   | 3 ORCHARDFIELD AVENUE,<br>BROOMHALL,<br>EDINBURGH,<br>EH12 7SX |
|--------------------|--|
|                    |  |
| Customer           | Mr Andrew Ross and Mrs Flora Ross                              |
|                    |  |
| Customer address   |  |
|                    |  |
|                    |  |
|                    |  |
|                    |  |
| Prepared by        | DM Hall LLP  |
|                    |  |
| Date of inspection | 26th March 2024  |



#### **PART 1 - GENERAL**

#### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

Х

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

#### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

<sup>&</sup>lt;sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

#### 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
  or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

#### 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

#### 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

#### 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

<sup>&</sup>lt;sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

they assign the same to any other party in writing.

#### 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

#### 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

#### 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

#### 1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

#### PART 2 - DESCRIPTION OF THE REPORT

#### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

#### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

#### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

#### 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

#### 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

#### 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

#### 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

#### 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

| Description                    | The property comprises a main door lower flat within a two storey traditional terrace.   |
|--------------------------------|--|
| Accommodation                  | Ground Floor: Vestibule, entrance hall, living room, kitchen, two bedrooms, bathroom.  |
| Gross internal floor area (m²) | 70 or thereby.   |
| Neighbourhood and location     | Established residential area where surrounding properties are broadly similar in terms of age, type and character, lying to the west of Edinburgh City Centre, convenient for local amenities. |
| Age                            | Built circa 1910.  |
| Weather                        | Overcast.  |
| Chimney stacks                 | Visually inspected with the aid of binoculars where appropriate.   |
|                                | From ground level the chimney stacks were seen to be of rendered masonry.  |
| Roofing including roof space   | Sloping roofs were visually inspected with the aid of binoculars where appropriate.  |
|                                | Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.   |
|                                | Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.                               |
|                                | If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe  |

| Roofing including roof space        | From ground level the roof was seen to be of traditional timber pitched design clad externally with slates with flat sections to the rear clad in a bituminous type roofing felt. |
|-------------------------------------|---|
| Rainwater fittings                  | Visually inspected with the aid of binoculars where appropriate.  |
|                                     | Cast iron construction in addition to uPVC construction.  |
| Main walls                          | Visually inspected with the aid of binoculars where   |
|                                     | appropriate.  Foundations and concealed parts were not exposed or   |
|                                     | Inspected.  The main walls appear to be of rendered brick with a stone frontage.  |
|                                     |   |
| Windows, external doors and joinery | Internal and external doors were opened and closed where keys were available.   |
|                                     | Random windows were opened and closed where possible.   |
|                                     | Doors and windows were not forced open.   |
|                                     | Windows are of uPVC double glazed sash and case type. The access door is of timber construction.  |
| External decorations                | Wassellis 'n anasta l   |
| External decorations                | Visually inspected.   |
|                                     | The cast iron rainwater goods and external timbers are painted.   |
| Conservatories / porches            | Not applicable.   |
| Communal areas                      | Not applicable.   |
| Garages and permanent outbuildings  | Not applicable.   |
|                                     |   |
| Outside areas and boundaries        | Visually inspected.   |
|                                     | The subjects benefit from areas of private garden ground to the front and rear.   |
| Ceilings                            | Visually inspected from floor level.  |
|                                     | Lath and plaster/plasterboard construction.   |
|                                     | Lancado diasiendiasiendano constitucion   |

| Internal walls                        | Visually inspected from floor level.   |
|---------------------------------------|--|
|                                       |  |
|                                       | Using a moisture meter, walls were randomly tested for dampness where considered appropriate.  |
|                                       | Plastered masonry in addition to lath and plaster and plasterboard lined.  |
| Floors including sub floors           | Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.   |
|                                       | Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.   |
|                                       | Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.   |
|                                       | Suspended timber in addition to solid masonry. Fitted floor coverings throughout.  |
| Internal joinery and kitchen fittings | Puilt in cuphords were looked into but no stored items were  |
| internal joinery and kitchen fittings | Built-in cupboards were looked into but no stored items were moved.  |
|                                       | Kitchen units were visually inspected excluding appliances.  |
|                                       | Doors, skirtings, etc are of timber construction. The kitchen is fitted with a range of floor and wall mounted storage units.  |
| Chimney breasts and fireplaces        | Visually inspected.  |
|                                       | No testing of the flues or fittings was carried out.   |
| Internal decorations                  | Visually inspected.  |
|                                       | Internal decorative finishes are mostly paint.   |
| Cellars                               | Not applicable.  |
| Electricity                           | Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.  Mains supply with fuse board located in the vestibule cupboard. |

| Gas                                | Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.  Mains supply with meter located externally. |
|------------------------------------|--|
| Water, plumbing, bathroom fittings | Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.  No tests whatsoever were carried out to the system or  |
|                                    | appliances.  |
|                                    | Mains supply. Sanitary arrangements comprise a three piece bathroom suite. No inspection beneath the bath.   |
| Heating and hot water              | Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.  |
|                                    | No tests whatsoever were carried out to the system or appliances.  |
|                                    | Gas fired central heating with combi boiler located in the kitchen.  |
| Drainage                           | Drainage covers etc were not lifted.   |
|                                    | Neither drains nor drainage systems were tested.   |
|                                    | Mains.   |
|                                    |  |
| Fire, smoke and burglar alarms     | Visually inspected.  |
|                                    | No tests whatsoever were carried out to the system or appliances.  |
|                                    |  |
|                                    | Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.                     |

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent

#### Any additional limits to inspection

that the surveyor is able to give an opinion on the general condition and standard of maintenance.

The services were not tested.

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor. Any such materials should not be drilled or disturbed without prior advice from a licensed specialist.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

The property was occupied, fully furnished and all floors were covered. Floor coverings restricted my inspection of flooring.

Personal effects in cupboards and fitted wardrobes were not moved and restricted my inspection.

No inspection of any roof void area.

My inspection of the roof covering was restricted from ground level and some parts were not visible. The flat roof coverings were not visible from ground level.


I was not able to inspect the sub floor area due to no visible hatches.

Concealed areas beneath and around the bath were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

### Sectional Diagram showing elements of a typical house

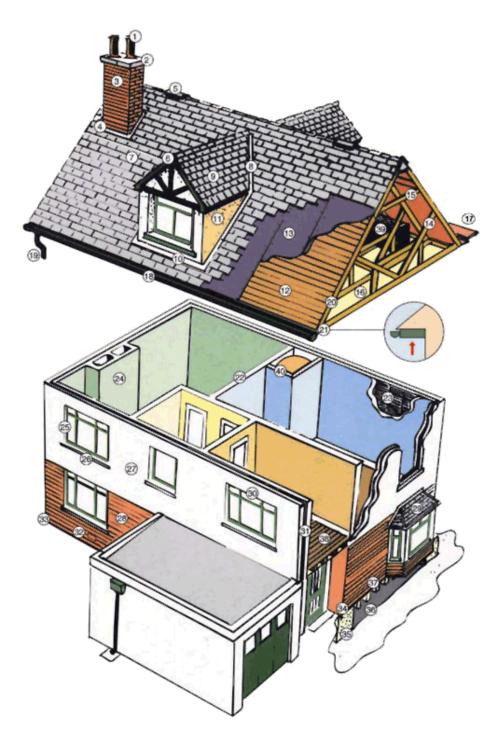

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- 4 Flashing
- 5) Ridge ventilation
- 6 Ridge board
- 7) Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- 12) Sarking
- (13) Roof felt
- (14) Trusses
- (15) Collar
- 16 Insulation
- 17) Parapet gutter
- 18) Eaves guttering
- 19) Rainwater downpipe
- 20) Verge boards /skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- 25) Window pointing
- Williagow bolligili
- 26) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29) Bay window projection
- 30 Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33) Damp proof course
- 34) Base course
- 35) Foundations
- (36) Solum
- 37) Floor joists
- 38) Floorboards
- 39) Water tank
- 40 Hot water tank

#### 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

| Category 3   | Category 2  | Category 1                               |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

| Structural movement |  |
|---------------------|--|
| Repair category     | 1  |
| Notes               | There is movement in the property evidenced by sloping floors, door lintels off level, cracking to masonry etc. There is no evidence of recent stress to the building within the limitations of the inspection but previous scarring has been reflected in the market value. |

| Dampness, rot and infestation |   |
|-------------------------------|---|
| Repair category               | 1   |
| Notes                         | There is evidence previous damp remedial repair works having been carried out. Copies of any relevant guarantees should be transferred and retained with the Title Deeds. |

| Chimney stacks  |   |
|-----------------|---|
| Repair category | 1   |
| Notes           | We have been informed that the chimney stacks have recently been re-rendered.  Details should be sought and any guarantees transferred. |

| Roofing including roof space |  |
|------------------------------|--|
| Repair category              | 2  |
| Notes                        | There are a number of slipped and cracked slates. The flat bitumen felt roof covering has a limited life expectancy and can fail without warning. Inspection at close quarters may reveal further deterioration/damage to roofing materials, especially where these are original. A reputable roofing contractor will be able to provide further advice. |

| Rainwater fittings |   |
|--------------------|---|
| Repair category    | 2   |
| Notes              | Metal rainwater fittings are corroded in places. These should be treated and redecorated. Metal rainwater fittings require regular maintenance. |

| Main walls      |   |
|-----------------|---|
| Repair category | 2   |
| Notes           | The rendering of outer walls is cracked and bossed in places and pointing to the stonework requires attention. This can be repaired by a competent local builder. |

| Windows, external doors and joinery |   |
|-------------------------------------|---|
| Repair category                     | 1   |
| Notes                               | No significant defects evident.  The windows have recently installed and may still be under warranty. Details should be sought. |

| External decorations |   |
|----------------------|---|
| Repair category      | 1   |
| Notes                | Regular re-painting of external joinery will prolong its life span. |

| Conservatories/porches |                 |
|------------------------|-----------------|
| Repair category        | -               |
| Notes                  | Not applicable. |

| Communal areas  |                 |
|-----------------|-----------------|
| Repair category | -               |
| Notes           | Not applicable. |

| Garages and permanent outbuildings |                 |
|------------------------------------|-----------------|
| Repair category                    | -               |
| Notes                              | Not applicable. |

| Outside areas and boundaries |                                 |
|------------------------------|---------------------------------|
| Repair category              | 1                               |
| Notes                        | No significant defects evident. |

| Ceilings        |                                 |
|-----------------|---------------------------------|
| Repair category | 1                               |
| Notes           | No significant defects evident. |

| Internal walls  |                                 |
|-----------------|---------------------------------|
| Repair category | 1                               |
| Notes           | No significant defects evident. |

| Floors including sub-floors |   |
|-----------------------------|---|
| Repair category             | 1   |
| Notes                       | Sections of flooring are uneven.  It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work. |

| Internal joinery and kitchen fittings |   |
|---------------------------------------|---|
| Repair category                       | 2   |
| Notes                                 | Wear and tear noted to the kitchen surfaces.  Glazed inserts to interior doors may not be of appropriate toughened glass or meet the recognised Building Standards. |

| Chimney breasts and fireplaces |   |
|--------------------------------|---|
| Repair category                | 1   |
| Notes                          | Where fireplaces have been removed there is limited provision for ventilation. Unventilated chimney breasts can result in condensation. Disused chimneys should be capped and vented. |

| Internal decorations |                                 |
|----------------------|---------------------------------|
| Repair category      | 1                               |
| Notes                | No significant defects evident. |

| Cellars         |                 |
|-----------------|-----------------|
| Repair category | -               |
| Notes           | Not applicable. |

| Electricity     |  |
|-----------------|--|
| Repair category | 1  |
| Notes           | It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations. |

| Gas             |  |
|-----------------|--|
| Repair category | 1  |
| Notes           | Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations. |

| ► Water, plumbing and | d bathroom fittings  |
|-----------------------|--|
| Repair category       | 1  |
| Notes                 | Seals/grouting should be regularly maintained to avoid water leakage which can result in dampness/decay in hidden areas of the property. |

| Heating and hot wat | er   |
|---------------------|--|
| Repair category     | 1  |
| Notes               | It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations.  Boilers and central heating systems should be tested and serviced by a Gas Safe |
|                     | registered contractor on an annual basis to ensure their safe and efficient operation.   |

| Drainage        |                                 |
|-----------------|---------------------------------|
| Repair category | 1                               |
| Notes           | No significant defects evident. |

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

| Structural movement                   | 1 |
|---------------------------------------|---|
| Dampness, rot and infestation         | 1 |
| Chimney stacks                        | 1 |
| Roofing including roof space          | 2 |
| Rainwater fittings                    | 2 |
| Main walls                            | 2 |
| Windows, external doors and joinery   | 1 |
| External decorations                  | 1 |
| Conservatories/porches                | - |
| Communal areas                        | - |
| Garages and permanent outbuildings    | - |
| Outside areas and boundaries          | 1 |
| Ceilings                              | 1 |
| Internal walls                        | 1 |
| Floors including sub-floors           | 1 |
| Internal joinery and kitchen fittings | 2 |
| Chimney breasts and fireplaces        | 1 |
| Internal decorations                  | 1 |
| Cellars                               | - |
| Electricity                           | 1 |
| Gas                                   | 1 |
| Water, plumbing and bathroom fittings | 1 |
| Heating and hot water                 | 1 |
| Drainage                              | 1 |

#### **Category 3**

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

#### Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

#### Category 1

No immediate action or repair is needed.

#### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

#### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

#### 3. Accessibility information

#### Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

| 1. Which floor(s) is the living accommodation on?                                      | Ground Floor. |
|--|---------------|
| 2. Are there three steps or fewer to a main entrance door of the property?             | Yes X No      |
| 3. Is there a lift to the main entrance door of the property?                          | Yes No X      |
| 4. Are all door openings greater than 750mm?   | Yes No X      |
| 5. Is there a toilet on the same level as the living room and kitchen?                 | Yes X No      |
| 6. Is there a toilet on the same level as a bedroom?                                   | Yes X No      |
| 7. Are all rooms on the same level with no internal steps or stairs?                   | Yes X No      |
| 8. Is there unrestricted parking within 25 metres of an entrance door to the building? | Yes X No      |

#### 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

#### Matters for a solicitor or licensed conveyancer

It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

The subjects form part of a block of flats and it has been assumed that maintenance/repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed.

#### Estimated reinstatement cost for insurance purposes

£325,000 (THREE HUNDRED AND TWENTY-FIVE THOUSAND POUNDS).

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

#### Valuation and market comments

£295,000 (TWO HUNDRED AND NINETY-FIVE THOUSAND POUNDS).

Against a backdrop of changing economic circumstances and increasing interest rates, it is not possible to predict how the market will perform in the coming months although market conditions continue to be stable at present.

| Signed         | Security Print Code [499640 = 8407 ] Electronically signed |
|----------------|--|
|                |  |
| Report author  | Kirsten Nicolson   |
|                |  |
| Company name   | DM Hall LLP  |
|                |  |
| Address        | 17 Corstorphine Road, Edinburgh, EH12 6DD                  |
| <u> </u>       |  |
| Date of report | 28th March 2024  |
|                |  |



| <b>Property Address</b>                      |   |
|--|---|
| Address Seller's Name Date of Inspection     | 3 ORCHARDFIELD AVENUE, BROOMHALL, EDINBURGH, EH12 7SX<br>Mr Andrew Ross and Mrs Flora Ross<br>26th March 2024   |
| <b>Property Details</b>                      |   |
| Property Type                                | House Bungalow Chalet Purpose built maisonette Coach Studio Converted maisonette X Purpose built flat Converted flat Flat over non-residential use Other (specify in General Remarks)     |
| Property Style                               | □ Detached       □ Semi detached       □ Mid terrace       □ End terrace         □ Back to back       □ High rise block       X Low rise block       □ Other (specify in General Remarks) |
| Does the surveyor be e.g. local authority, m | elieve that the property was built for the public sector, Yes X No nilitary, police?  |
| Flats/Maisonettes onl                        | No. of units in block 2   |
| Approximate Year of                          | Construction 1910   |
| Tenure                                       |   |
| X Absolute Ownership                         | Leasehold Ground rent £ Unexpired years   |
| Accommodation                                |   |
| Number of Rooms                              | 1 Living room(s) 2 Bedroom(s) 1 Kitchen(s) 1 Bathroom(s) 1 WC(s) 0 Other (Specify in General remarks)   |
| Gross Floor Area (ex                         | cluding garages and outbuildings) 70 m² (Internal) 80 m² (External)   |
| Residential Element (                        | (greater than 40%) X Yes No   |
| Garage / Parking /                           | Outbuildings  |
| Single garage Available on site?             | □ Double garage       □ Parking space         □ Yes       □ No             X No garage / garage space / parking space   |
| Permanent outbuildin                         | igs:  |
| None.  |   |

| Construction                           |                        |                   |            |                 |             |             |            |           |                |                |
|--|------------------------|-------------------|------------|-----------------|-------------|-------------|------------|-----------|----------------|----------------|
| Walls                                  | Brick                  | Stone             | Пс         | oncrete         | Timb        | er frame    |            |           |                |                |
|  | Solid                  | Cavity            | □<br>□s    | teel frame      | Cond        | crete block | X          | Other (s  | specify in Ger | neral Remarks) |
| Roof                                   | Tile                   | Slate             | <br>A      | sphalt          | Felt        |             |            |           |                |                |
|  | Lead                   | Zinc              | A          | rtificial slate | e 🗌 Flat (  | glass fibre | X          | Other (s  | specify in Ger | neral Remarks) |
| Special Risks                          |                        |                   |            |                 |             |             |            |           |                |                |
| Has the property s                     | uffered structu        | ıral moveme       | nt?        |                 |             |             |            |           | X Yes          | No             |
| If Yes, is this recer                  | nt or progressi        | ve?               |            |                 |             |             |            |           | Yes            | X No           |
| Is there evidence, immediate vicinity? | history, or reas       | son to antici     | pate sub   | sidence, I      | heave, l    | andslip o   | or flood i | n the     | Yes            | X No           |
| If Yes to any of the                   | above, provid          | de details in     | General    | Remarks         |             |             |            |           |                |                |
| O                                      | ···                    |                   |            |                 |             |             |            |           |                |                |
| Service Connect                        |                        |                   |            |                 |             |             |            |           |                |                |
| Based on visual in of the supply in Ge |                        |                   | es appea   | ar to be n      | on-mair     | ns, pleas   | e comm     | ent on    | the type a     | nd location    |
| Drainage                               | X Mains                | Private           | None       |                 |             | Water       | X Mair     | ns        | Private        | None           |
| Electricity                            | X Mains                | Private           | None       |                 |             | Gas         | X Mair     | ns        | Private        | None           |
| Central Heating                        | X Yes                  | Partial           | None       |                 |             |             |            |           |                |                |
| Brief description of                   | Central Heati          | ng:               |            |                 |             |             |            |           |                |                |
| Gas fired central                      | heating with b         | oiler to radia    | ators.     |                 |             |             |            |           |                |                |
| Site                                   |                        |                   |            |                 |             |             |            |           |                |                |
| Apparent legal issu                    | ues to be verifi       | ed by the co      | nveyanc    | er. Pleas       | e provid    | le a brief  | descrip    | tion in   | General R      | emarks.        |
| Rights of way                          | Shared drive           | -                 |            | e or other a    | -           |             | _          | 1         | d service conr |                |
| Agricultural land inc                  | <br>cluded with proper | ty                | III-defin  | ed bounda       | ries        |             |            | Other (   | specify in Ge  | neral Remarks) |
| Location                               |                        |                   |            |                 |             |             |            |           |                |                |
|  | V Dooi:                | dential within to | uun / oitu | Mixad           | rasidantia  | 1 / aamma   | raial      | Moinly    | aommaraial     |                |
| Residential suburb                     |                        |                   | wn / city  |                 |             | al / comme  | rciai      |           | commercial     | naral Damarka) |
| Commuter village                       | ∐ Kem                  | ote village       |            |                 | ed rural pr | орепу       |            | ] Other ( | specify in Ge  | neral Remarks) |
| Planning Issues                        |                        |                   |            |                 |             |             |            |           |                |                |
| Has the property b                     | een extended           | / converted       | / altered  | ? X Y           | es No       | )           |            |           |                |                |
| If Yes provide deta                    | ails in General        | Remarks.          |            |                 |             |             |            |           |                |                |
| Roads                                  |                        |                   |            |                 |             |             |            |           |                |                |
| X Made up road                         | Unmade road            | Partly            | completed  | new road        | — Pe        | edestrian a | ccess onl  | y         | Adopted        | Unadopted      |

| General Remarks  |
|--|
| General Remarks  |
| The subjects are located within an established residential area where surrounding properties are broadly similar in terms of age, type and character, lying to the west of Edinburgh City Centre, convenient for local amenities.  |
| At the time of inspection it was noted that the subjects have been adequately maintained commensurate with age and type of construction. Ongoing maintenance to the external building fabric should be anticipated.  |
| The main walls are of rendered brick with a stone frontage, beneath a pitched and slated roof with flat sections to the rear clad in a bituminous type roofing felt.   |
| There is movement in the property evidenced by sloping floors, door lintels off level, cracking to masonry etc. There is no evidence of recent stress to the building within the limitations of the inspection but previous scarring has been reflected in the market value.   |
| The subjects have been altered including reconfiguration of bedroom 2 and the bathroom. It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt. |
|  |
|  |
|  |
|  |
| Essential Repairs  |

Retention recommended? Yes No

Estimated cost of essential repairs  ${\mathfrak L}$  [

Amount £[

| Comment on Mortgageability  |   |                             |  |
|---|---|-----------------------------|--|
| In our opinion the subjects   | s offer suitable security subject to individual lender's requirements.  |                             |  |
| Valuations  |   |                             |  |
| Market value in present condition  Market value on completion of essential repairs  Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT) Is a reinspection necessary?  Buy To Let Cases |   | £ 295,000<br>£<br>£ 325,000 |  |
| What is the reasonable rangementh Short Assured Tenar   | ge of monthly rental income for the property assuming a letting on a 6 ncv basis?   | £                           |  |
|   | here there is a steady demand for rented accommodation of this type?  | Yes No                      |  |
| Declaration   |   |                             |  |
| Signed Surveyor's name Professional qualifications Company name Address Telephone   | Security Print Code [499640 = 8407] Electronically signed by:- Kirsten Nicolson MRICS DM Hall LLP 17 Corstorphine Road, Edinburgh, EH12 6DD 0131 624 6600 |                             |  |
| Fax 0131 624 6609  Report date 28th March 2024  |   |                             |  |

# **Energy Performance Certificate (EPC)**

Dwellings

# **Scotland**

#### 3 ORCHARDFIELD AVENUE, BROOMHALL, EDINBURGH, EH12 7SX

Dwelling type:Ground-floor flatDate of assessment:26 March 2024Date of certificate:28 March 2024

Total floor area: 70 m<sup>2</sup>

Primary Energy Indicator: 213 kWh/m²/year

**Reference number:** 2565-1021-4207-8314-0204 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, mains


gas

#### You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

| Estimated energy costs for your home for 3 years* | £3,285 | See your recommendations       |
|---|--------|--------------------------------|
| Over 3 years you could save*                      | £792   | report for more<br>information |

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

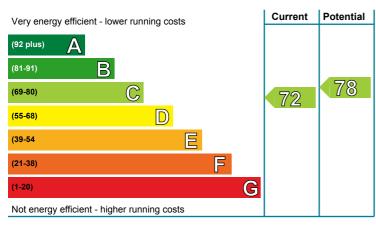


#### **Energy Efficiency Rating**

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (72)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

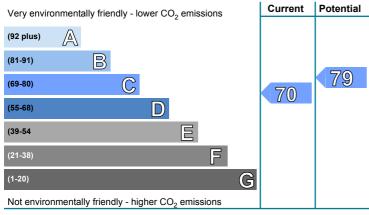

#### **Environmental Impact (CO<sub>2</sub>) Rating**

This graph shows the effect of your home on the environment in terms of carbon dioxide ( $CO_2$ ) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (70)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

### Top actions you can take to save money and make your home more efficient

| Recommended measures                   | Indicative cost  | Typical savings over 3 years |
|--|------------------|------------------------------|
| 1 Cavity wall insulation               | £500 - £1,500    | £252.00                      |
| 2 Internal or external wall insulation | £4,000 - £14,000 | £240.00                      |
| 3 Floor insulation (suspended floor)   | £800 - £1,200    | £156.00                      |

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

#### Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

| Element               | Description   | Energy Efficiency | Environmental |
|-----------------------|---|-------------------|---------------|
| Walls                 | Sandstone or limestone, as built, no insulation (assumed) | ***               | ***           |
|                       | Cavity wall, as built, no insulation (assumed)            | ***               | ***           |
| Roof                  | (another dwelling above)                                  | _                 | <del>_</del>  |
| Floor                 | Suspended, no insulation (assumed)                        | _                 | _             |
|                       | Solid, no insulation (assumed)                            | _                 | _             |
| Windows               | Fully double glazed                                       | <b>★★★★</b> ☆     | <b>★★★★</b> ☆ |
| Main heating          | Boiler and radiators, mains gas                           | <b>★★★</b> ☆      | <b>★★★★</b> ☆ |
| Main heating controls | Programmer, room thermostat and TRVs                      | <b>★★★★</b> ☆     | <b>★★★★</b> ☆ |
| Secondary heating     | None  | _                 | _             |
| Hot water             | From main system  | <b>★★★★</b> ☆     | <b>★★★★</b> ☆ |
| Lighting              | Low energy lighting in all fixed outlets                  | ****              | ****          |

#### The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

### The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 38 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.6 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.7 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

#### Estimated energy costs for this home

|           | Current energy costs | Potential energy costs | Potential future savings |
|-----------|----------------------|------------------------|--------------------------|
| Heating   | £2,520 over 3 years  | £1,725 over 3 years    |                          |
| Hot water | £462 over 3 years    | £465 over 3 years      | You could                |
| Lighting  | £303 over 3 years    | £303 over 3 years      | save £792                |
| Totals    | £3,285               | £2,493                 | over 3 years             |

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

#### **Recommendations for improvement**

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

| Recommended measures |                                      | Indicative cost  | Typical saving | Rating after improvement |             |
|----------------------|--------------------------------------|------------------|----------------|--------------------------|-------------|
|                      |                                      | Indicative cost  | per year       | Energy                   | Environment |
| 1                    | Cavity wall insulation               | £500 - £1,500    | £84            | C 74                     | C 73        |
| 2                    | Internal or external wall insulation | £4,000 - £14,000 | £80            | C 76                     | C 76        |
| 3                    | Floor insulation (suspended floor)   | £800 - £1,200    | £52            | C 77                     | C 77        |
| 4                    | Floor insulation (solid floor)       | £4,000 - £6,000  | £49            | C 78                     | C 79        |

#### **Alternative measures**

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

External insulation with cavity wall insulation

### Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



#### About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

#### 1 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

#### 2 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

#### 3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

#### 4 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

#### Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

#### Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

| Heat demand                  | Existing dwelling | Impact of loft insulation | Impact of cavity wall insulation | Impact of solid wall insulation |
|------------------------------|-------------------|---------------------------|----------------------------------|---------------------------------|
| Space heating (kWh per year) | 8,094             | N/A                       | (994)                            | (949)                           |
| Water heating (kWh per year) | 1,800             |                           |                                  |                                 |

#### **Addendum**

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

#### **About this document**

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mrs. Kirsten Nicolson

Assessor membership number: EES/017924

Company name/trading name: D M Hall Chartered Surveyors LLP

Address: 17 Corstorphine Road

Edinburgh EH12 6DD

Phone number: 0131 624 6600

Email address: kirsten.nicolson@dmhall.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

#### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

#### Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



# **Property Questionnaire**

| Property Address | 3 Orchardfield Avenue, Corstorphine |
|------------------|-------------------------------------|
|                  | Edinburgh                           |
|                  | EH12 7SX                            |

| Completion date of property questionnaire | 20/03/2024 |
|---|------------|
|---|------------|

| 1              | Length of ownership How long have you owned the prop 5 years 7 months   | perty?  |  |
|----------------|---|---|--|
| 2              | Council tax Which Council Tax band is your pro  | operty in?  |  |
| 3              | Allocated parking space Driveway Shared parking On street Resident permit   | king at your property?  □ □ □ □ □ □ □ □ □ □ □ □ □ □ □ □ □ □ |  |
| 4              | Conservation area Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)? Yes  |   |  |
| 5              | <b>Listed buildings</b> Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)? No   |   |  |
| <b>6</b> a.(i) | Alterations/additions/extensions  During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?  No  If you have answered yes, please describe below the changes which you have made: |   |  |
| (ii)           | Did you obtain planning permission, building warrant, completion certificate and other consents for this work?  |   |  |
|                | should give them to your solicitor a  | ourself, please note below who has these documents          |  |

Have you had replacement windows, doors, patio doors or double glazing installed in your

b.

property?

Yes

If you have answered yes, please answer the three questions below:

(i) Were the replacements the same shape and type as the ones you replaced?

(ii) Did this work involve any changes to the window or door openings?

(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):

Replaced all windows with double glazed sash and case uPVC. Originally single glazed sash and case timber frame.

Please give any guarantees which you received for this work to your solicitor or estate agent.

#### 7 Central heating

a. Is there a central heating system in your property?

(Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).

Yes

If you have answered yes or partial — what kind of central heating is there?

(Examples: gas-fired, solid fuel, electric storage heating, gas warm air).

Gas-fired

If you have answered yes, please answer the three questions below:

- (i) When was your central heating system or partial central heating system installed? 2013
- (ii) Do you have a maintenance contract for the central heating system?

If you have answered yes, please give details of the company with which you have a maintenance contract:

(iii) When was your maintenance agreement last renewed? (Please provide the month and year).

### 8 Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old?

Yes

### 9 Issues that may have affected your property

a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

b. Are you aware of the existence of asbestos in your property?

No

If you have answered yes, please give details:

#### 10 Services

Please tick which services are connected to your property and give details of the supplier: **Services Connected Supplier EDF** Gas or liquid petroleum gas  $\overline{\mathbf{Q}}$ Water mains or private water supply  $\overline{\mathbf{A}}$ Scottish Water Electricity  $\overline{\mathbf{V}}$ EDF  $\sqrt{\phantom{a}}$ Mains drainage Scottish Water Telephone Cable TV or satellite  $\overline{\mathbf{A}}$ Virgin Broadband  $\overline{\mathbf{A}}$ Virgin Is there a septic tank system at your property? b. Do you have appropriate consents for the discharge from your septic tank? (i) Do you have a maintenance contract for your septic tank? (ii) If you have answered yes, please give details of the company with which you have a maintenance contract: 11 Responsibilities for shared or common areas Are you aware of any responsibility to contribute to the cost of anything used jointly, such as a. the repair of a shared drive, private road, boundary, or garden area? No If you have answered yes, please give details: Is there a responsibility to contribute to repair and maintenance of the roof, common b. stairwell or other common areas? Yes If you have answered yes, please give details: Roof - responsibility shared with one flat above. Has there been any major repair or replacement of any part of the roof during the time you C. have owned the property? Yes Do you have the right to walk over any of your neighbours' property — for example to put d. out your rubbish bin or to maintain your boundaries? No If you have answered yes, please give details: As far as you are aware, do any of your neighbours have the right to walk over your e. property, for example to put out their rubbish bin or to maintain their boundaries? No

f. As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)

If you have answered yes, please give details:

If you have answered yes, please give details:

### 12 Charges associated with your property

a. Is there a factor or property manager for your property?

b. Is there a common buildings insurance policy?

No

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

c. Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.

#### 13 Specialist works

a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?

Yes

If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.

Damp proof work and woodworm treatment carried out in 2013 (previous owners)

b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?

Yes

If you have answered yes, please give details:

As part of treatment in 2013 (previous owners)

c. If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate., these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

Guarantees are held by:

We have copies provided by previous owners

#### 14 Guarantees

- a. Are there any guarantees or warranties for any of the following:
- (i) Electrical work

No

(ii) Roofing

No

(iii) Central heating

No

(iv) National House Building Council (NHBC)

No

(v) Damp course

Yes

(vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)

No

- b. <u>If you have answered 'yes'</u> or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):
- (i) Electrical work
- (ii) Roofing
- (iii) Central heating
- (iv) National House Building Council (NHBC)
- (v) Damp course

Chemical damp proof course to living room, bedrooms, kitchen, bathroom (previous owners)

- (vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)
- c. Are there any outstanding claims under any of the guarantees listed above?

If you have answered yes, please give details:

#### 15 Boundaries

So far as your are aware, has any boundary of your property been moved in the last 10 years?

No

If you have answered yes, please give details:

### 16 Notices that affect your property

In the past three years have you ever received a notice:

- a. advising that the owner of a neighbouring property has made a planning application? Yes
- b. that affects your property in some other way?
- c. that requires you to do any maintenance, repairs or improvements to your property?

If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the

purchaser of your property.